

Tree

Primary ID:	8548
Tree Number:	
Tag Number:	T3
Inspection Type:	Reactive
Status:	Alive
Common Name:	Lombardy poplar
Scientific Name:	Populus nigra 'Italica'
Code:	PONI
Genus:	Populus
Cultivar:	
Family:	Salicaceae
DBH (inches):	31.496080000000003
Number of Stems:	1
DBH [cm]:	80
DBH Stem 1:	
DBH Stem 2:	
DBH Stem 3:	
DBH Stem 4:	
DBH Stem 5:	
DBH Stem 6:	
DBH Range [cm]:	>75cm
Form:	
Tree Height [m]:	14
Height Range [m]:	10-20 Metres
Crown Spread [m]:	3-6
Crown Radius N [m]:	
Crown Radius E [m]:	
Crown Radius S [m]:	
Crown Radius W [m]:	
Crown Radius Average:	
Life Stage:	Mature
Vitality:	Poor
Structural Condition:	Poor
Percent Dieback (%):	50-75%

Photos



17902602744393365880912592170684.jpg
24/09/2026



17902604028068710722624132510972.jpg
24/09/2026

TPO:	True
Tree of Cultural Significance/Special Merit:	False
Council Tree:	Yes
Last Inspection:	28/09/2026
Inspection Cycle:	3 Years
Next Inspection:	28/09/2029
Inspection Status:	Inspected
Tree Comments:	Recommend Felling and Stump Grinding due to poor condition of tree crown and roots and its co-dominant neighbours, resulting in high exposure if some trees are removed and not others, combined with extremely high target high street location between busy public highway and supermarket carpark and in falling distance of housing, telegraph lines, street lighting, carpark and store.
Archived:	No
Has Ecobenefits:	No

Location	
Ward:	Royston
Ward Allocation:	Katherine Church
Address:	51 High Street
City:	Royston
Post Code:	SG8 9AW
Growing Space:	Narrow Verge
Park Name:	
Land Ownership:	Other Council
Adopted Highway Tree:	Yes
Crown Light Exposure:	Four sides of the crown are exposed to light.
Longitude:	-1.458692541527



17902609630042119133204068451073.jpg
24/09/2026



17902610147598627060205194487717.jpg
24/09/2026



17902613476837842969500008131938.jpg
24/09/2026

Latitude:	53.598052667762
-----------	-----------------


Observations	
Leaning:	<20%
Crown Class:	Co-dominant
Crown Observations:	Included Bark, Major deadwood
Crown Comments:	Snapped off dead branch hung up over pavement
Trunk Observations:	Climber Restricting Inspection, Epicormic Growth at Base
Trunk Comments:	5 - 10% lean to west
Root Observations:	Decay, Excavation Damage, Exposed Roots, Surface Root Damage
Root Comments:	Sounding suggested significant decay to buttress root closest to pavementLikely from Aldi carpark construction and wall approx 3m from edge of stem
Pests, Pathogens & Diseases:	Pests - Other
PPD Comments:	All 3 trees were completely defoliated in 2025 due to a satin moth infestation
Ecological Considerations:	
Clearance Conflicts:	
Wires:	Present and Conflicting
Observations (upload):	

CAVAT (Quick)	
DBH [cm]:	80
Basic Value (£):	
Community Tree Index (CTI):	
CTI Value (£):	
Functional Factor:	

Street View



Map

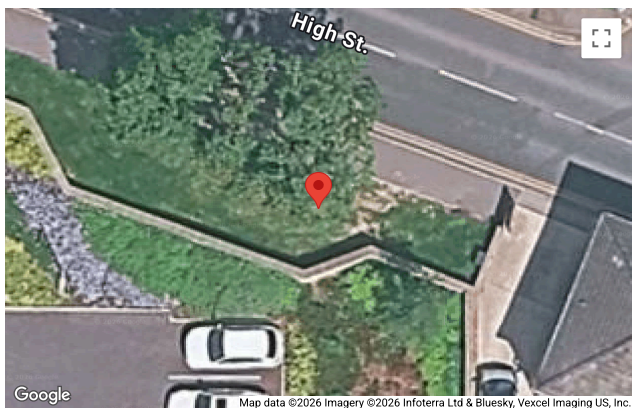

Most Recent Changes to this Tree

katherinechurch set Trunk Comments="5 - 10% lean to west" on Sep 28, 2026 at 7:23pm

katherinechurch set Leaning="<20%" on Sep 28, 2026 at 7:21pm

katherinechurch set Tree Comments="Recommend Felling and Stump Grinding due to poor c..." on Sep 28, 2026 at 2:54pm

katherinechurch set Tree Comments="Recommend Felling and Stump Grinding due to poor c..." on Sep 28, 2026 at 2:53pm

katherinechurch set Tag Number="T3" on Sep 28, 2026 at 2:44pm

katherinechurch set DBH [cm]="80" on Sep 24, 2026 at 4:20pm

katherinechurch set Crown Comments="Snapped off dead branch hung up over pavement" on Sep 24, 2026 at 4:17pm

katherinechurch set Photos="179026027443933658809125921706

Functional Factor (%):
Functional Value (£):
Life Expectancy:
Final Appraisal Value (£):
CAVAT Notes:

Construction	
Root Protection Area (RPA) [m]:	9.600000000000001

Planting
Planting Status:
Client:
Pit Number:
Surface:
Pit Size:
Planting Site Width:
Nursery:
Size of Container:
Stock Size (Width) [cm]:
Planting Comments:
Attachments:

Misc	
Added By:	katherinechurch
Date Added:	23/09/2026
Last Modified By:	katherinechurch
Last Modified:	28/09/2026
Photos (upload):	

Work Records, Work History
No results

Tree Inspections					
INSPECTION ID	INSPECTION NOTES	INSPECTED BY	DATE	TREE HEIGHT [M]	VITALITY
7265		katherinechurch	23/09/2026	14	Poor

84.jpg, 179026040280..." on Sep 24, 2026 at 3:49pm

katherinechurch set Root
Comments="Sounding suggested significant decay to buttress r..." on Sep 24, 2026 at 3:48pm

katherinechurch set Root
Comments="Sounding deLikely from Aldi carpark construction a..." on Sep 24, 2026 at 3:47pm

INSPECTION ID	INSPECTION NOTES	INSPECTED BY	DATE	TREE HEIGHT [M]	VITALITY
7266	Recommend Felling and Stump Grinding due to poor condition of tree crown and roots and its co-dominant neighbours, resulting in high exposure if some trees are removed and not others, combined with extremely high target high street location between busy public highway and supermarket carpark and in falling distance of housing, telegraph lines, street lighting, carpark and store. TWA required	katherinech urch	28/09 /2026	14	Poor
Report Prepared: September 28, 2026					