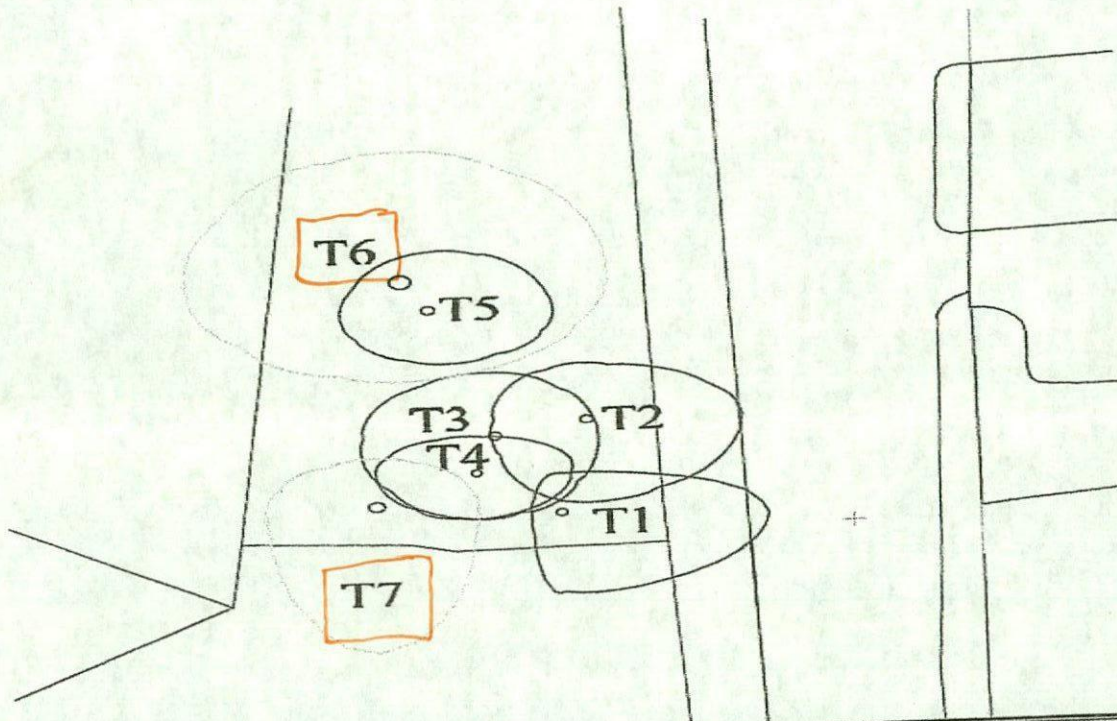


Existing Tree Plan

Tree ID	Tree Species		Measurements			Crown (m)					Tree Condition					Management				
	Common Name	Latin Name	Age/Stage	Height (m)	DBH (cm)	Retained	Av Height	N	E	S	W	Roots	Stem	Crown	Comments	Pruned	Structural	Life expectancy	Works	
T1	Ash	<i>Fraxinus excelsior</i>	Early Mature	8	4	230, 200, 190, 180	No	2	25	6	5	1	Likely to be growing out to the damaged boundary retaining wall	Multiple stemmed at base. Significant lean.	Unbalanced. Overhanging adjacent land.	Overhanging road. No long term value	Fair	Poor	10 to 20 yrs	Remove
T2	Sycamore	<i>Acer pseudoplatanus</i>	Mature	17	1	480	No	7	3.5	6	5	3.5	Likely to be growing out to the damaged boundary retaining wall	Single stemmed. Slight lean. Bark damage.	Unbalanced. Overhanging adjacent land.	Overhanging road. Limited value.	Fair	Fair	20 to 40 yrs	Remove
T3	Sycamore	<i>Acer pseudoplatanus</i>	Mature	15	1	480	No	10	4	4	5	5	Likely to be growing out to the damaged boundary retaining wall	Single stemmed. Vertical. Bark damage.	Small/ sparse. High crown	Limited long term value.	Fair	Fair	20 to 40 yrs	Remove
T4	Sycamore	<i>Acer pseudoplatanus</i>	Early-mature	15	1	380	No	8	2	4	3	3.5	Likely to be growing out to the damaged boundary retaining wall	Single stemmed. Bark damage.	Small/ sparse. Moderate deadwood. Slightly reticulated.	Suppressed by larger trees. No long term value.	Fair	Fair	>40 yrs	Remove
T5	Horse Chestnut	<i>Aesculus hippocastanum</i>	Mature	15	1	520	No	7	4	4	3	4	No visual defects	Single stemmed. Bark damage. Minor cavities. Minor decay. Slight lean.	Small/ sparse. Discolouration of leaves from leaf miner.	Wells in stem. Probable bleeding canker.	Fair	Fair	20 to 40 yrs	Remove
T6	Oak	<i>Quercus robur</i>	Mature	19	1	840	No	9	6	8	6	8	Decay. Damage to buttress roots.	Single stemmed. Bark damage. Vertical.	Normal. Slightly unbalanced.	Unbalanced due to previous adjacent trees which have since been removed.	Good	Good	>40 yrs	No action
T7	Oak	<i>Quercus robur</i>	Mature	17	1	600	No	8	3	4	9	4	No visual defects	Single stemmed. Slight lean. Bark damage.	Normal. Minor deadwood. Overhanging adjacent land.	Historic stem damage with reaction growth.	Good	Good	>40 yrs	No action

**The Institution
of Structural
Engineers**

Director : Ian R Thorpe BEng (Hons) CEng MStructE