R&B Rock Drillers Limited

To Whom it May Concern

Drilling site at Shaw Lane Cricket/Rugby Club - Barnsley on 8/2/2011

An exploratory drilling programme was undertaken on the 8th February 2011.

This programme comprised of six holes in number to a depth of thirty meters using conventional rotary air flush drilling techniques.


The holes were drilled and logs taken by R & B Rock Drillers Ltd using a Halco 450H air flush drilling rig with a Holman compressor.

No voids were detected in any of the six holes and no air flush was lost at any time, indicating there was no presence of any abnormalities in the rock strata.

A J Sharp

Alan J Sharp
Managing Director

Hazel Lane Quarry, Hampole, Doncaster, South Yorkshire DN6 7EY.
Telephone: (01302) 722702 Fax: (01302) 729404
Company Registration Number 1308689 Directors: A. Sharp, M. Sharp, A.J. Sharp

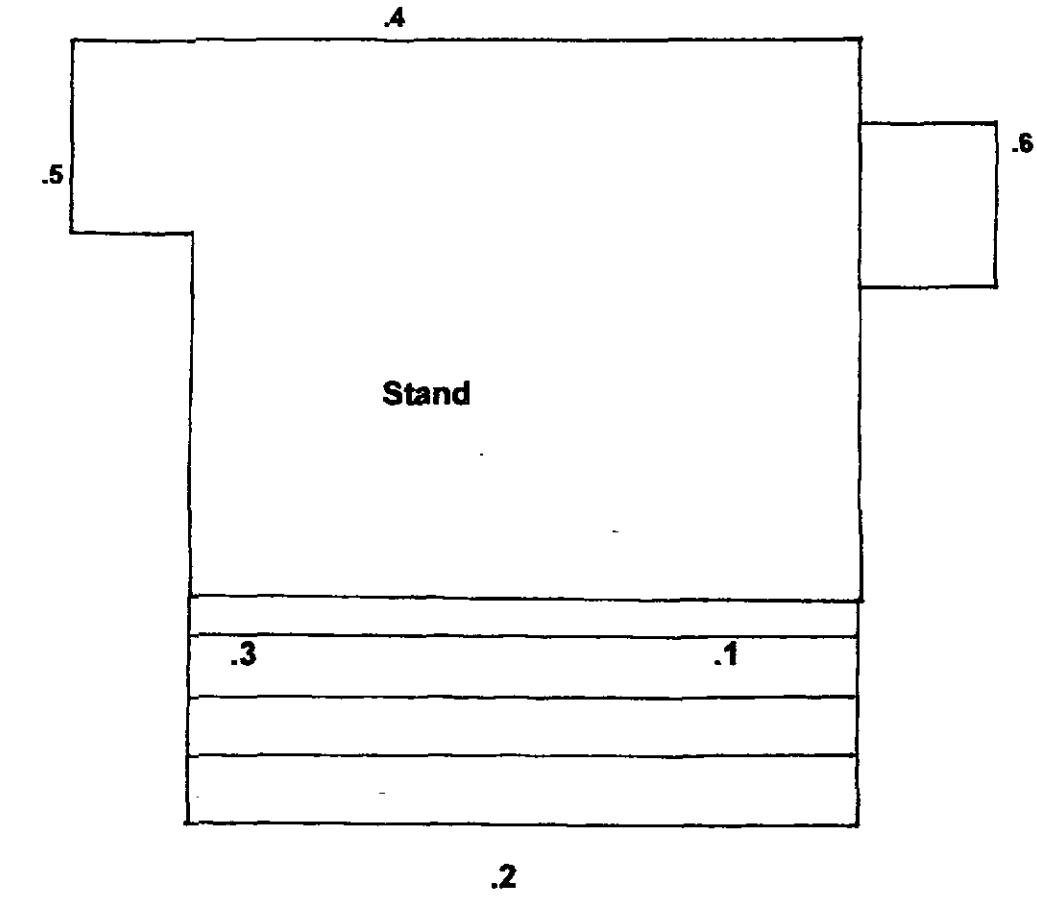




Pitch

R & B Rock Drillers Ltd Hazel Lane Quarry Hampole Doncaster DN6 7EY

Bore Hole Log

Site: Shaw Lane Cricket/Rugby Club - Barnsley
Customer: Eric Lidster
Hole No: 1 - 6
Driller: Brian Harris - Malcolm Darbyshire
Date: 8th February 2011

Bore Hole 1

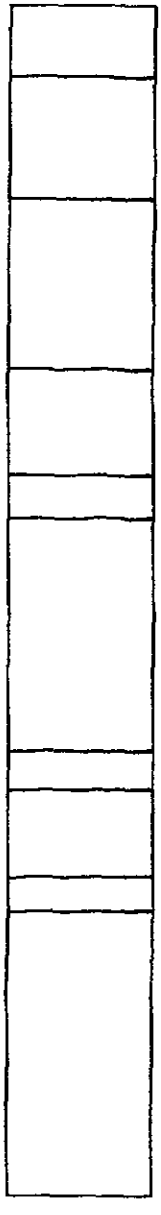

0.0 - 0.2 Concrete

0.2 - 4.5 Fill/Clay

4.5 - 9.0 Mudstone

9.0 - 12.0 Siltstone

12.0 - 13.0 Sandstone

13.0 - 20.5 Mudstone

20.5 - 20.6 Coal

20.6 - 24.0 Mudstone

24.0 - 24.2 Coal


24.2 - 30.0 Mudstone

R & B Rock Drillers Ltd Hazel Lane Quarry Hampole Doncaster DN6 7EY

Bore Hole Log

Site:	**Shaw Lane Cricket/Rugby Club - Barnsley**
Customer:	**Eric Lidster**
Hole No:	**1 - 6**
Driller:	**Brian Harris - Malcolm Darbyshire**
Date:	**8th February 2011**

Bore Hole 2

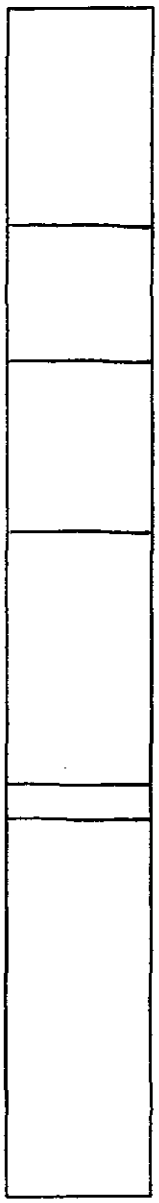

0.0 - 4.5 Fill/Clay

4.5 - 8.0 Mudstone

8.0 - 12.0 Siltstone

12.0 - 20.0 Mudstone

20.0 - 20.1 Coal


20.1 - 30.0 Mudstone

R & B Rock Drillers Ltd Hazel Lane Quarry Hampole Doncaster DN6 7EY

Bore Hole Log

Site: Shaw Lane Cricket/Rugby Club - Barnsley
Customer: Eric Lidster
Hole No: 1 - 6
Driller: Brian Harris - Malcolm Darbyshire
Date: 8th February 2011

Bore Hole 3

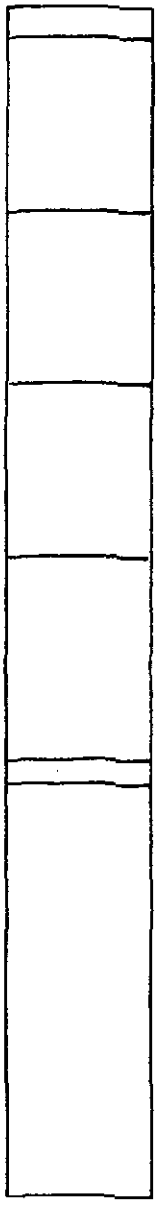

0.0 - 0.2 Concrete

0.2 - 4.5 Fill/Clay

4.5 - 9.0 Mudstone

9.0 - 13.5 Siltstone

13.5 - 21.0 Mudstone

21.0 - 21.1 Coal


21.1 - 30.0 Mudstone

R & B Rock Drillers Ltd Hazel Lane Quarry Hampole Doncaster DN6 7EY

Bore Hole Log

Site: Shaw Lane Cricket/Rugby Club - Barnsley
Customer: Eric Lidster
Hole No: 1 - 6
Driller: Brian Harris - Malcolm Darbyshire
Date: 8th February 2011

Bore Hole 4

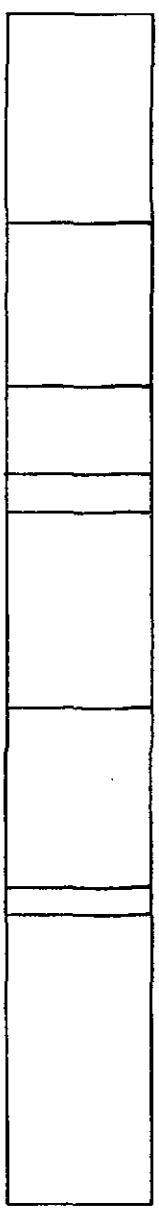

0.0 - 5.0 Clay

5.0 - 10.0 Mudstone

10.0 - 12.5 Siltstone

12.5 - 13.0 Sandstone

13.0 - 17.0 Siltstone

17.0 - 20.5 Mudstone

20.5 - 21.3 Coal


21.3 - 30.0 Mudstone

R & B Rock Drillers Ltd Hazel Lane Quarry Hampole Doncaster DN6 7EY

Bore Hole Log

Site: Shaw Lane Cricket/Rugby Club - Barnsley
Customer: Eric Lidster
Hole No: 1 - 6
Driller: Brian Harris - Malcolm Darbyshire
Date: 8th February 2011

Bore Hole 5

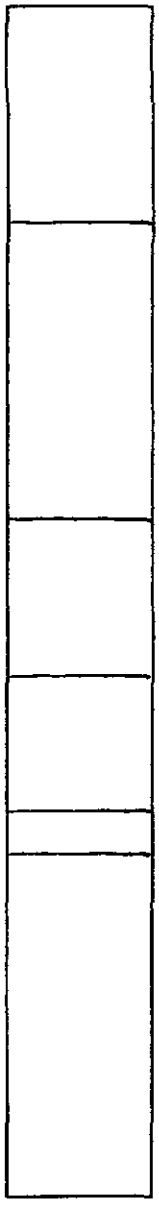

0.0 - 5.0 Clay

5.0 - 13.0 Mudstone

13.0 - 17.0 Siltstone

17.0 - 21.0 Mudstone

21.0 - 21.3 Coal


21.3 - 30.0 Mudstone

R & B Rock Drillers Ltd Hazel Lane Quarry Hampole Doncaster DN6 7EY

Bore Hole Log

Site: Shaw Lane Cricket/Rugby Club - Barnsley
Customer: Eric Lidster
Hole No: 1 - 6
Driller: Brian Harris - Malcolm Darbyshire
Date: 8th February 2011

Bore Hole 6

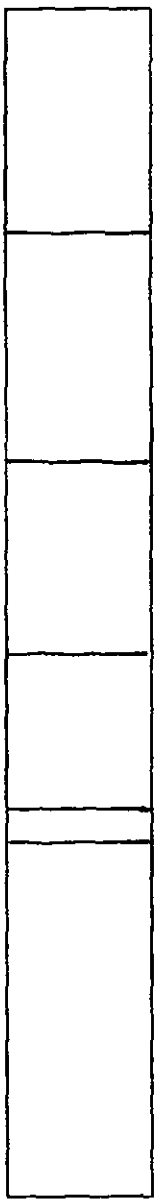

0.0 - 5.0 Clay

5.0 - 11.0 Mudstone

11.0 - 16.0 Siltstone

16.0 - 20.0 Mudstone

20.0 - 20.0 Coal

20.0 - 30.0 Mudstone