

**Orchard View Care Home
39 Gawber Road
Barnsley**

Pre-development Arboricultural Report

**Prepared at the request of
Peter Thompson Architect**

29 October 2020

**By
Ian Kennedy
Wharnccliffe Trees and Woodland Consultancy**

All rights in this report are reserved. No part of it may be reproduced or transmitted, in any form or by any means, electronic, mechanical, recording or otherwise, or stored in any retrieval system of any nature, without written permission. Its content and format are for the exclusive use of the addressee in respect of this site. It may not be sold, lent, hired out or divulged to any third party not directly involved in this site without written consent.

Summary

I have been instructed to carry out a pre-development tree survey of the significant trees in the garden of Orchard View Care Home, 39 Gawber Road, Barnsley.

The approximate locations of the trees are recorded on Plan 1 that shows the existing site layout.

Table 1 records their species, dimensions, age, life expectancy, any defects and their amenity value. This information was collected, interpreted and recorded in accordance with BS5837:2012 *Trees in relation to design, demolition and construction – Recommendations*. The information is used to attribute retention categories to the trees; A, B, C and U. These retention categories are described in Appendix 2.

The trees are growing along the southern and western boundaries of the property. Many are relatively small trees, including fruit trees that don't contribute greatly to the local area. These are included in the lowest retention category 'C' (shown grey on plan 1).

A small number of larger trees on the edge of Gawber Road are included in the higher retention category 'B' because of their good health and prominence in the local landscape.

Plan 2 shows the proposed layout with the crown spreads and root protection areas plotted.

Section 4 of the report is the impact assessment that discusses the impact of the proposed layout on the trees.

Plan 3 is the tree protection plan that shows how trees should be protected if they are to be retained as part of development.

The proposed development would have a limited impact on the existing trees at the property.

CONTENTS

1	INTRODUCTION	6
1.1	Instruction	6
1.2	Documents and Provided Information	6
1.3	Limitations	6
2	SITE VISIT AND OBSERVATIONS	7
2.1	Site visit	7
2.2	Brief Site description	7
2.3	Development Proposals	7
2.4	Locations of the Trees	7
2.5	Tree observations	8
3	Interpretation of Information and References	11
3.1	BS5837:2012 Tree Retention Categories	11
3.2	Below Ground Constraints; Root Protection Areas (RPAs)	11
3.3	Above Ground Constraints; Crown Spreads.....	12
3.4	Conception and Design.....	12
4	ARBORICULTURAL IMPACT ASSESSMENT	13
4.1	Arboricultural Impact Assessment	13
4.2	General considerations for tree protection	14
Levels	14
Ground surface materials	14
Site access.....	14
Storing fuel, materials and equipment.....	15
Activity under tree canopies	15
5	ARBORICULTURAL METHOD STATEMENT	16
5.1	Specific Tree Protection Measures	16
5.2	General Tree Protection Measures	16
6	REFERENCES, PLANNING POLICY AND GUIDANCE.....	17
6.1	National policy	17
6.2	British Standard: Trees in relation to design, demolition and construction – Recommendations (BS 5837, 2012)	18
6.3	Barnsley Metropolitan Borough Council	18
7	CONCLUSIONS.....	19
8	LEGAL CONSIDERATIONS	20
8.1	Protected trees.....	20
8.2	Wildlife conservation legislation	20

TABLES

Table 1	The Tree Survey.....	8
Table 2	Summary of the impacts of the proposals on the trees.....	14

PLANS

Plan 1	Tree constraints plan of the existing site layout	21
Plan 2	Tree constraints plan of the proposed site layout	22
Plan 3	Tree protection plan of the existing site layout	23

APPENDICES

Appendix 1	The Experience and Qualifications of Ian Kennedy	24
Appendix 2	Tree Retention Categories.....	26
Appendix 3	Explanatory notes for some of the terms used in this report	27
Appendix 4	Suggested tree protection taken from BS5837:2012	29
Appendix 5	Example of a sign to attach to tree protective fencing	31

1 INTRODUCTION

1.1 Instruction

I have been instructed by Peter Thompson Architect to carry out a pre-development tree survey of the significant trees in the grounds of Orchard View Car Home, Gawber Road, Barnsley.

The tree survey is intended to provide a structured, impartial assessment of the tree population that could be affected by a proposed development.

The survey is intended to be informative to all stages of the development process and was carried out in accordance with *BS5837: 2012 Trees in relation to design, demolition and construction – Recommendations*.

1.2 Documents and Provided Information

I was provided with the following documents:

Plan showing the existing and proposed layout with the positions of the trees plotted.

1.3 Limitations

This report is concerned only with assessing the condition of the trees, their importance in the local landscape and any cultural and conservation values.

It takes no account of the affects the trees may have on the soil, such as heave where trees are removed or shrinkage where trees are retained.

Trees are dynamic organisms influenced by weather, pests and diseases. Therefore, this report can only remain valid for a period of 24 months.

Any works around the trees such as trenching, pruning, storage of materials and trafficking that has not first been approved by a suitably qualified arboriculturalist will invalidate this report.

This report has been prepared for pre-development purposes. Whilst the condition of the trees has been assessed this is primarily to attribute a retention category. It is not a tree condition and safety report and may not include the same level of detail on tree health and structural condition.

No decay detection equipment was used to gather information on the condition of the trees.

All survey and inspection was completed at ground level.

2 SITE VISIT AND OBSERVATIONS

2.1 Site visit

I visited the property on 09 October 2020 to complete the survey.

All dimensions were taken using recognised methodology and arboricultural measuring equipment, unless otherwise stated.

The principles of BS5837:2012 were applied to the assessment and evaluation of the trees.

The weather at the time of inspection was bright to sunny. Winds were light and visibility was good.

2.2 Brief Site description

Orchard View Care Home is situated to the north of Gawber Road, east of Greenfoot Lane and south of Palm Street, Barnsley at UK Grid Reference SE 33501 07049.

The home is a large, modern building in the northern part of the grounds. The southern part of the grounds includes the car park and open space area where most of the trees are growing.

2.3 Development Proposals

The development proposes an extension to the main building that will be connected to the existing building by the western gable end.

The extension would be located in the large area of open garden to the west of the car park.

2.4 Locations of the Trees

The positions of the trees were provided to me on a topographical survey plan of the site.

In accordance with BS5837: 2012 significant trees have a stem diameter greater than 150mm, measured 1.5m above ground level. This is because smaller trees could be transplanted or easily and quickly replaced if necessary.

2.5 Tree observations

Table 1. The Tree Survey

Tree number	Species	Height (M)	Stem diameter (DBH in MM)	Branch spread (M)	Ht first branch above GL* (M)	Ht of canopy above GL (M)	Life stage	Health	General observations on the tree's condition	Estimated life in years	Amenity value	Category
T1	Sycamore	12.0	180, 200, 260, 320	North – 3.0 South – 4.0 East – 4.0 West – 3.0	0.0	4.0	Young mature	Normal	A prominent tree on the frontage with Gawber Road. It is growing in a raised planter above the levels of the car park. It is in good health with no apparent defects but dense ivy is obscuring the stem.	20+	Medium	B (2)
T2	Sycamore	11.0	250	North – 3.0 South – 3.0 East – 2.0 West – 2.0	3.0	2.0	Juvenile mature	Normal	A prominent tree on the frontage with Gawber Road. It is growing in a raised planter above the levels of the car park. It is in good health with no apparent defects but dense ivy is obscuring the stem.	20+	Medium	B (2)

T3	Lime	10.0	550 #	North – 4.0 South – 4.0 East – 3.0 West – 3.5	4.0	3.0	Mature	Normal	<p>A prominent tree on the frontage with Gawber Road.</p> <p>It is growing in a raised planter above the levels of the car park.</p> <p>It is in good health with no apparent defects but dense ivy is obscuring the stem to 4m.</p>	20+	Medium	B (2)
T4	Pear	11.0	530	North – 3.8 South – 4.0 East – 4.5 West – 4.3	2.5	3.0	Old mature	Normal	<p>A large, old tree for the species.</p> <p>There is a decay cavity to the main stem that is occluding well. This is quite typical in old trees of the species.</p> <p>There are a number of small pruning wounds to the stem. These are occluding.</p> <p>The tree is quite prominent on the frontage of Gawber Road.</p>	20+	Medium	B (2)
T5	Oak	10.0	260	North – 3.9 South – 4.5 East – 2.1 West – 4.0	2.0	1.5	Juvenile mature	Normal	<p>A small, healthy tree with no apparent defects.</p> <p>There is dense ivy growing in the tree.</p>	40+	Low	C (1)
T6	Cherry	9.0	220 & 160	North – 3.0 South – 3.0 East – 4.0 West – 2.0	2.0	2.0	Young mature	Normal	<p>A small and insignificant but healthy tree.</p> <p>There is ivy growing into the crown.</p>	10+	Low	C (1)
T7	Pear	8.0	350 & 350	North – 3.4 South – 3.7 East – 3.1 West – 6.0	2.0	1.0	Old mature	Normal	<p>A large, old tree for the species.</p> <p>There are a number of small pruning wounds to the stem. These are occluding.</p> <p>The tree is quite prominent on the frontage of Greenfoot Lane.</p>	20+	Medium	B (2)

T8	Pear	10.0	440 & 330	North – 5.0 South – 5.0 East – 5.0 West – 4.0	3.0	1.5	Old mature	Normal	A large, old tree for the species. There is an acute stem union at the base that was stable at the time of inspection. The tree is quite prominent on the frontage of Greenfoot Lane.	20+	Medium	B (2)
G1	3 x apples	5.0	100 – 220	North – 2.0 South – 2.5 East – 2.6 West – 1.7	1.5	1.0	Mature	Normal	A small group of small, but mature trees. They are healthy but insignificant.	10+	Low	C (1)
G2	7 x apples	<5.0	<250	North – 3.0 South – 1.0 East – 2.0 West – 3.5	1.5	1.0	Mature	Moderate	A small group of small, but mature trees. They are healthy but insignificant.	10+	Low	C (1)
G3	2 x beech, 1 x Swedish whitebeam, 1 x goat willow	<9.0	<240	North – 4.5 South – 3.0 East – 4.6 West – 3.0	1.0	0.0	Juvenile mature	Normal	A group of young, small, insignificant trees in good health	10+	Low	C (1)
G4	Blackthorn and Norway maple	7.0	<150	North – 3.0 South – 2.0 East – 4.0 West – 2.0	0.0	0.0	Young mature	Normal	A dense group of mainly shrubs and small trees close to the boundary with Greenfoot Lane.	10+	Low	C (1)

3 Interpretation of Information and References

My interpretation and appraisal of information gathered from the survey is based on experience of tree species, visual risk hazard assessment and the guidance set out in BS5837:2012 *Trees in Relation to Design, Demolition, Construction – Recommendations*.

3.1 BS5837:2012 Tree Retention Categories

All trees have been assessed and assigned a retention category in accordance with Table 1 of the standard. A copy of Table 1 from BS5837: 2012 is included as Appendix 2.

This categorisation is intended to rank trees according to their importance in terms of quality, health, life expectancy, amenity and landscape value, together with wildlife and cultural importance. This ranking assists in determining the suitability and appropriateness of trees for retention in any development. Categories A to C are those considered for retention, 'A' being highest.

Category A and B trees tend to be considered more valuable for retention than category C trees.

Category 'U' trees are those not suitable for retention because of impaired condition.

Hedges and shrubs are not assigned retention categories but their heights and species are simply noted on the tree constraints plan.

3.2 Below Ground Constraints; Root Protection Areas (RPAs)

The root protection area is the area of land considered necessary for trees should they be retained as part of any development. This is calculated using the stem diameter measured at 1.5 metres from ground level. This protection area is shown diagrammatically as a circle centred on the base of the tree where it is expected that rooting has not been impeded in any one direction and where disturbance has not taken place. Where rooting has been impeded or disturbance taken place then the shape and size of the root protection area is modified according to an assessment of where rooting is likely to take place.

Where trees are to be retained, it is optimal to locate structures and services outside the RPA. However, where incursion becomes necessary, technical solutions may be possible to limit damage, areas lost can be compensated elsewhere, or the soil environment can be improved. In these circumstances an arboricultural method statement will be necessary to ensure that works are undertaken sympathetically and do not damage the below ground parts of the trees.

3.3 Above Ground Constraints; Crown Spreads

Ideally, working areas will be out with the crown spreads of trees to be retained.

Any permanent development proposed within the canopy spread of a tree should be assessed to determine whether the level of pruning necessary to accommodate the layout would be acceptable. However, the effects of shade and other perceived inconveniences of trees this close to property should also be considered, together with the future growth potential of the trees and the maintenance obligation this will bring.

Where temporary access by high sided vehicles and machinery for construction or erection of scaffolding is necessary within the crown spreads of trees to facilitate development an arboricultural method statement will be necessary to ensure pruning works are carried out sympathetically prior to demolition or construction works commencing.

3.4 Conception and Design

The constraints imposed by trees should assist with site design and layout, together with the other competing needs of development.

The provisions of services and the access space required for construction itself should be considered.

4 ARBORICULTURAL IMPACT ASSESSMENT

This section of the report considers the impact that the proposed layout could have on the trees that are included in Table 1 and shown on Plan 1; *Tree Constraints Plan showing the existing layout*.

This section discusses the engineering solutions that may be available to retain trees where development is proposed within their root protection areas (RPAs) or the pruning options available where development might affect crown spreads.

Where there is no option but to remove a tree to accommodate the proposed layout this section will discuss the impact on amenity and ecology and any mitigation that could be offered such as opportunities for replacement planting.

4.1 Arboricultural Impact Assessment

Most of the trees would be unaffected by the proposals. These are listed in Table 2 below.

Tree 7

The proposed soakaway would encroach slightly into one side of the RPA of this tree. Only a small area of the outer part of the RPA would be affected. This would be acceptable without detriment to the tree's health or stability.

Trees 4 and 8

The footprint of the building would encroach slightly into the northern and eastern parts of the RPAs of Trees 4 and 8 respectively. This encroachment alone would be acceptable. However, the proposed soakaways would encroach further into their RPAs. Total encroachment by the building and soakaways would be between one third and one half of each RPA. The southern half of the RPA of T4 and the western half of the RPA of T8 will have suboptimal rooting conditions because they are within the public highway. Therefore, rooting is likely to take place more into the site than normal. For these reasons I recommend that these tree are removed as part of the proposals. There is adequate space within the site along the boundary with Gawber Road or Greenfoot Lane to plant several replacement trees.

Group 3

This group of small trees would need to be removed to accommodate the proposed layout.

Group 4

The eastern edge of this group may need to be trimmed to provide adequate clearance. This group is mostly blackthorn which would lend itself to regular trimming as a boundary screen.

Table 2 Summary of the impacts of the proposals on the trees

Impact on trees	Category A trees	Category B trees	Category C trees	Category U trees
Unaffected	No category A trees.	T1, T2, T3, T5	T6, G1, G2, G4	No category U trees.
Buildings within RPAs		T4, T8	G3	
Buildings within crown spreads		T8	G3	
Roads, drives, parking or services within RPAs		T4, T7, T8		
Roads, drives or parking under crown spreads				

4.2 General considerations for tree protection

Levels

Altering the ground level within the RPAs of the trees may have a detrimental impact on their health and longevity.

Ground surface materials

Altering the ground cover, such as by using impervious or semi-pervious surface materials to cover areas that were previously vegetated soil, will alter the moisture content and recharge of the soil and its oxygen and carbon dioxide content. This could have a detrimental effect on the health of tree roots growing in it.

Site access

Vehicles and plant operating or parking on unprotected soil within the RPA of a retained tree could compact or contaminate it and this could have a detrimental impact on its long-term condition and longevity.

Storing fuel, materials and equipment

Storing fuel, equipment and materials close to trees increases the risk of damage to their trunks and branches, soil compaction and/or contamination with toxic substances.

Activity under tree canopies

Activity under tree canopies, such as mixing cement, lighting bonfires or storing equipment, plant and materials, may damage branches or stems. It may also be detrimental to soil within its RPA that is utilised by its roots.

5 ARBORICULTURAL METHOD STATEMENT

It is important that a method statement appropriate to the scale of development around retained trees is prepared, particularly where development or access is necessary within the RPAs and crown spreads of retained trees. This should address any eventuality that may involve working within the RPAs or crown spreads of existing trees. This will include temporary workings during construction as well as permanent incursion for surfacing.

5.1 Specific Tree Protection Measures

If the layout is implemented in its current form I recommend that tree protective fencing is erected at the positions shown on Plan 3 and to the standard illustrated in Appendix 4, or an alternative to be agreed with the local planning authority.

The fencing should be erected before any other work takes place on the site and should remain in place until the works are completed.

5.2 General Tree Protection Measures

To avoid damage to retained trees where no construction or access within RPAs and crown spreads is necessary the following should be followed during construction.

- No dumping or storing materials or waste, whether in a skip or on the ground.
- No temporary buildings, sheds, or offices without prior discussion with an arboriculturalist and agreement of the LPA.
- No storage of materials, equipment, plant, fuel or cement.
- No bonfires within 10m of the outer edge of the crown or RPA.
- No refuelling mechanical equipment or mixing of cement.
- No washing cement mixers within or uphill of the RPA.
- No vehicles and plant unless the soil is suitably protected as recommended an arboriculturalist and agreed by the LPA.
- No raising the soil level without prior discussion with an arboriculturalist and agreement of the Local Planning Authority (LPA).
- No excavations without prior discussion with an arboriculturalist and agreement of the LPA.
- No redirection of surface water runoff into or out of the RPA.
- Follow the guidance contained within the National Joint Utilities Group Volume 4 (Guidelines for the Planning, Installation and Maintenance of Utility Apparatus in Proximity to Trees (Issue 2, 2007); www.njug.org.uk) when installing underground services within the RPA of a retained tree.

6 REFERENCES, PLANNING POLICY AND GUIDANCE

6.1 National policy

Section 197 in the Town and Country Planning Act 1990 makes it the duty of Local Planning Authorities (LPAs), 'in the interests of amenity,' to protect trees, when granting planning permission, either by the imposition of conditions or serving Tree Preservation Orders (TPOs).

The National Planning Policy Framework (NPPF) mentions trees and should be taken into account.

170. Planning policies and decisions should contribute to and enhance the natural and local environment by:

b) recognising the intrinsic character and beauty of the countryside, and the wider benefits from natural capital and ecosystem services – including the economic and other benefits of the best and most versatile agricultural land, and of trees and woodland;

175. When determining planning applications, local planning authorities should apply the following principles:

c) development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused, unless there are wholly exceptional reasons⁵⁸ and a suitable compensation strategy exists;

Annex 2: Glossary

Ancient or veteran tree: A tree which, because of its age, size and condition, is of exceptional biodiversity, cultural or heritage value. All ancient trees are veteran trees. Not all veteran trees are old enough to be ancient, but are old relative to other trees of the same species. Very few trees of any species reach the ancient life-stage.

Ancient woodland: An area that has been wooded continuously since at least 1600 AD. It includes ancient semi-natural woodland and plantations on ancient woodland sites (PAWS).

Irreplaceable habitat: Habitats which would be technically very difficult (or take a very significant time) to restore, recreate or replace once destroyed, taking into account their age, uniqueness, species diversity or rarity. They include ancient woodland, ancient and veteran trees, blanket bog, limestone pavement, sand dunes, salt marsh and lowland fen.

6.2 British Standard: Trees in relation to design, demolition and construction – Recommendations (BS 5837, 2012)

The British Standard: *Trees in relation to design, demolition and construction – Recommendations* (BS 5837, 2012) contains guidance on how to assess trees in or close to proposed development and information to include in pre-development arboricultural reports submitted with planning applications. Appendices 2 and 3 contain relevant extracts from BS 5837 (2012).

6.3 Barnsley Metropolitan Borough Council

Barnsley Local Plan. Adopted January 2019

17. Green Infrastructure and Green Space

7 CONCLUSIONS

There are eight individual trees and four small group of trees included in this report.

One individual tree and four groups are included in the lowest highest retention category (C) because they are small and insignificant trees making little contribution to the area.

Seven trees are included in the higher retention category (B) because they are in good health and have high amenity value on the frontage of the property.

Most of the trees could be retained within the proposed layout.

Two individual trees (T4 and T8) and one group (G3) would need to be removed to accommodate the building and soakaways.

There is adequate space within the property to plant several replacement trees along the boundary with Gawber Road and Greenfoot Lane.

I believe that the proposals would have only a limited impact on tree cover at the property.

8 LEGAL CONSIDERATIONS

8.1 Protected trees

No checks have been made with the Local Planning Authority (LPA) for trees included in a Tree Preservation Order (TPO) or within a Conservation Area.


If any trees are protected by a TPO, are located in a conservation area or protected by planning conditions, it will be necessary to obtain permission from the LPA before any work, other than certain exempted operations, can be carried.


8.2 Wildlife conservation legislation

Breeding birds are protected, together with bats and their roosts are, whether their roosts are in use or not.

Consideration should be given to the presence of protected species prior to any proposed tree removal or maintenance. This will include breeding birds, principally between March and August, and bats at any time of year.

Tree surgeons should also be aware of their duties under legislation to protect wildlife and carry out their site assessment and work accordingly.

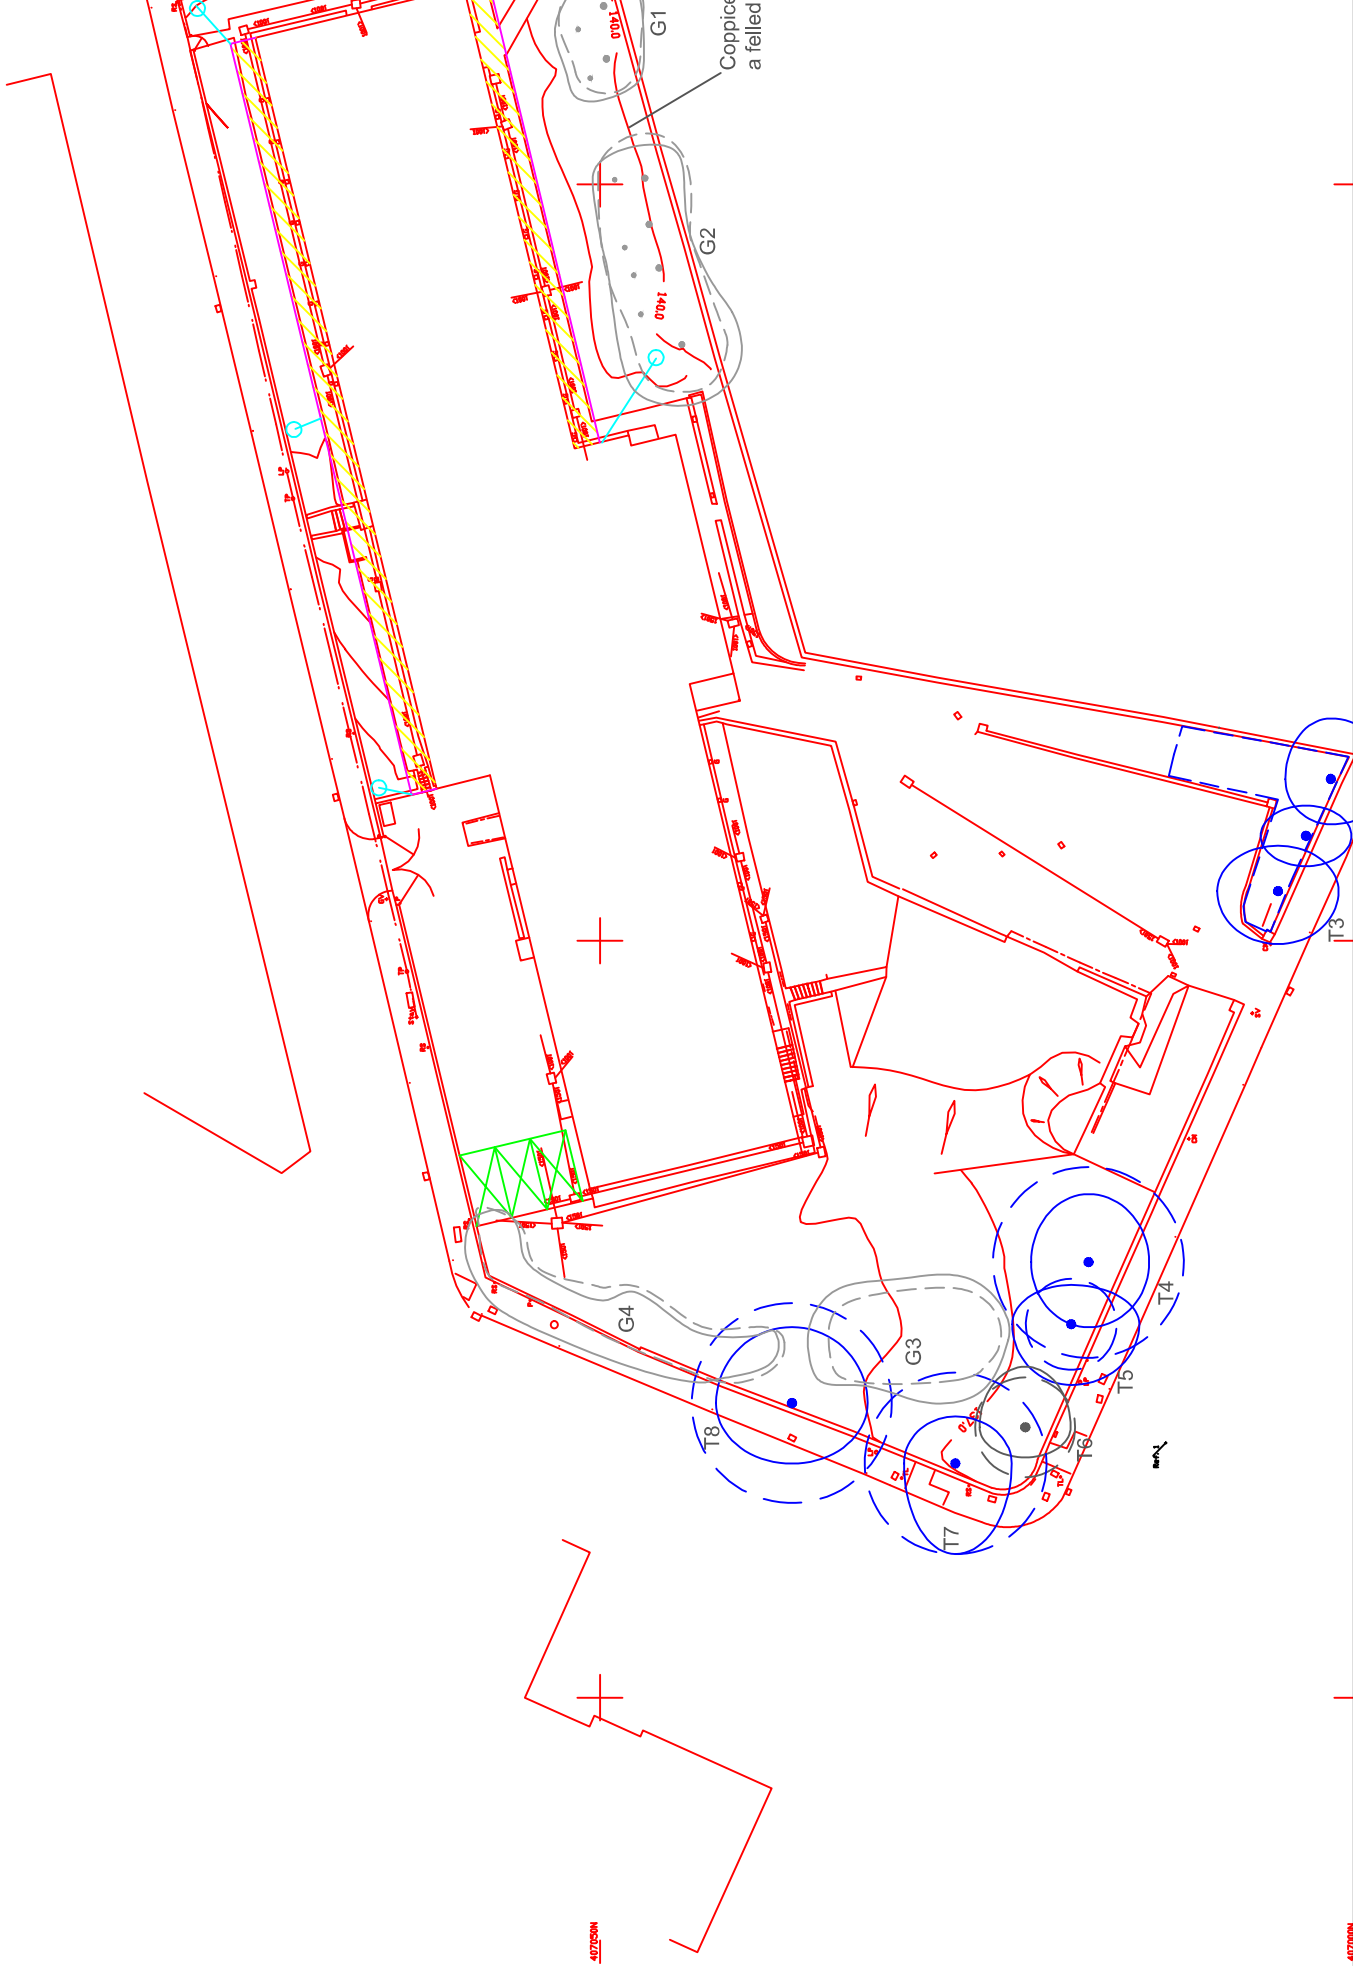

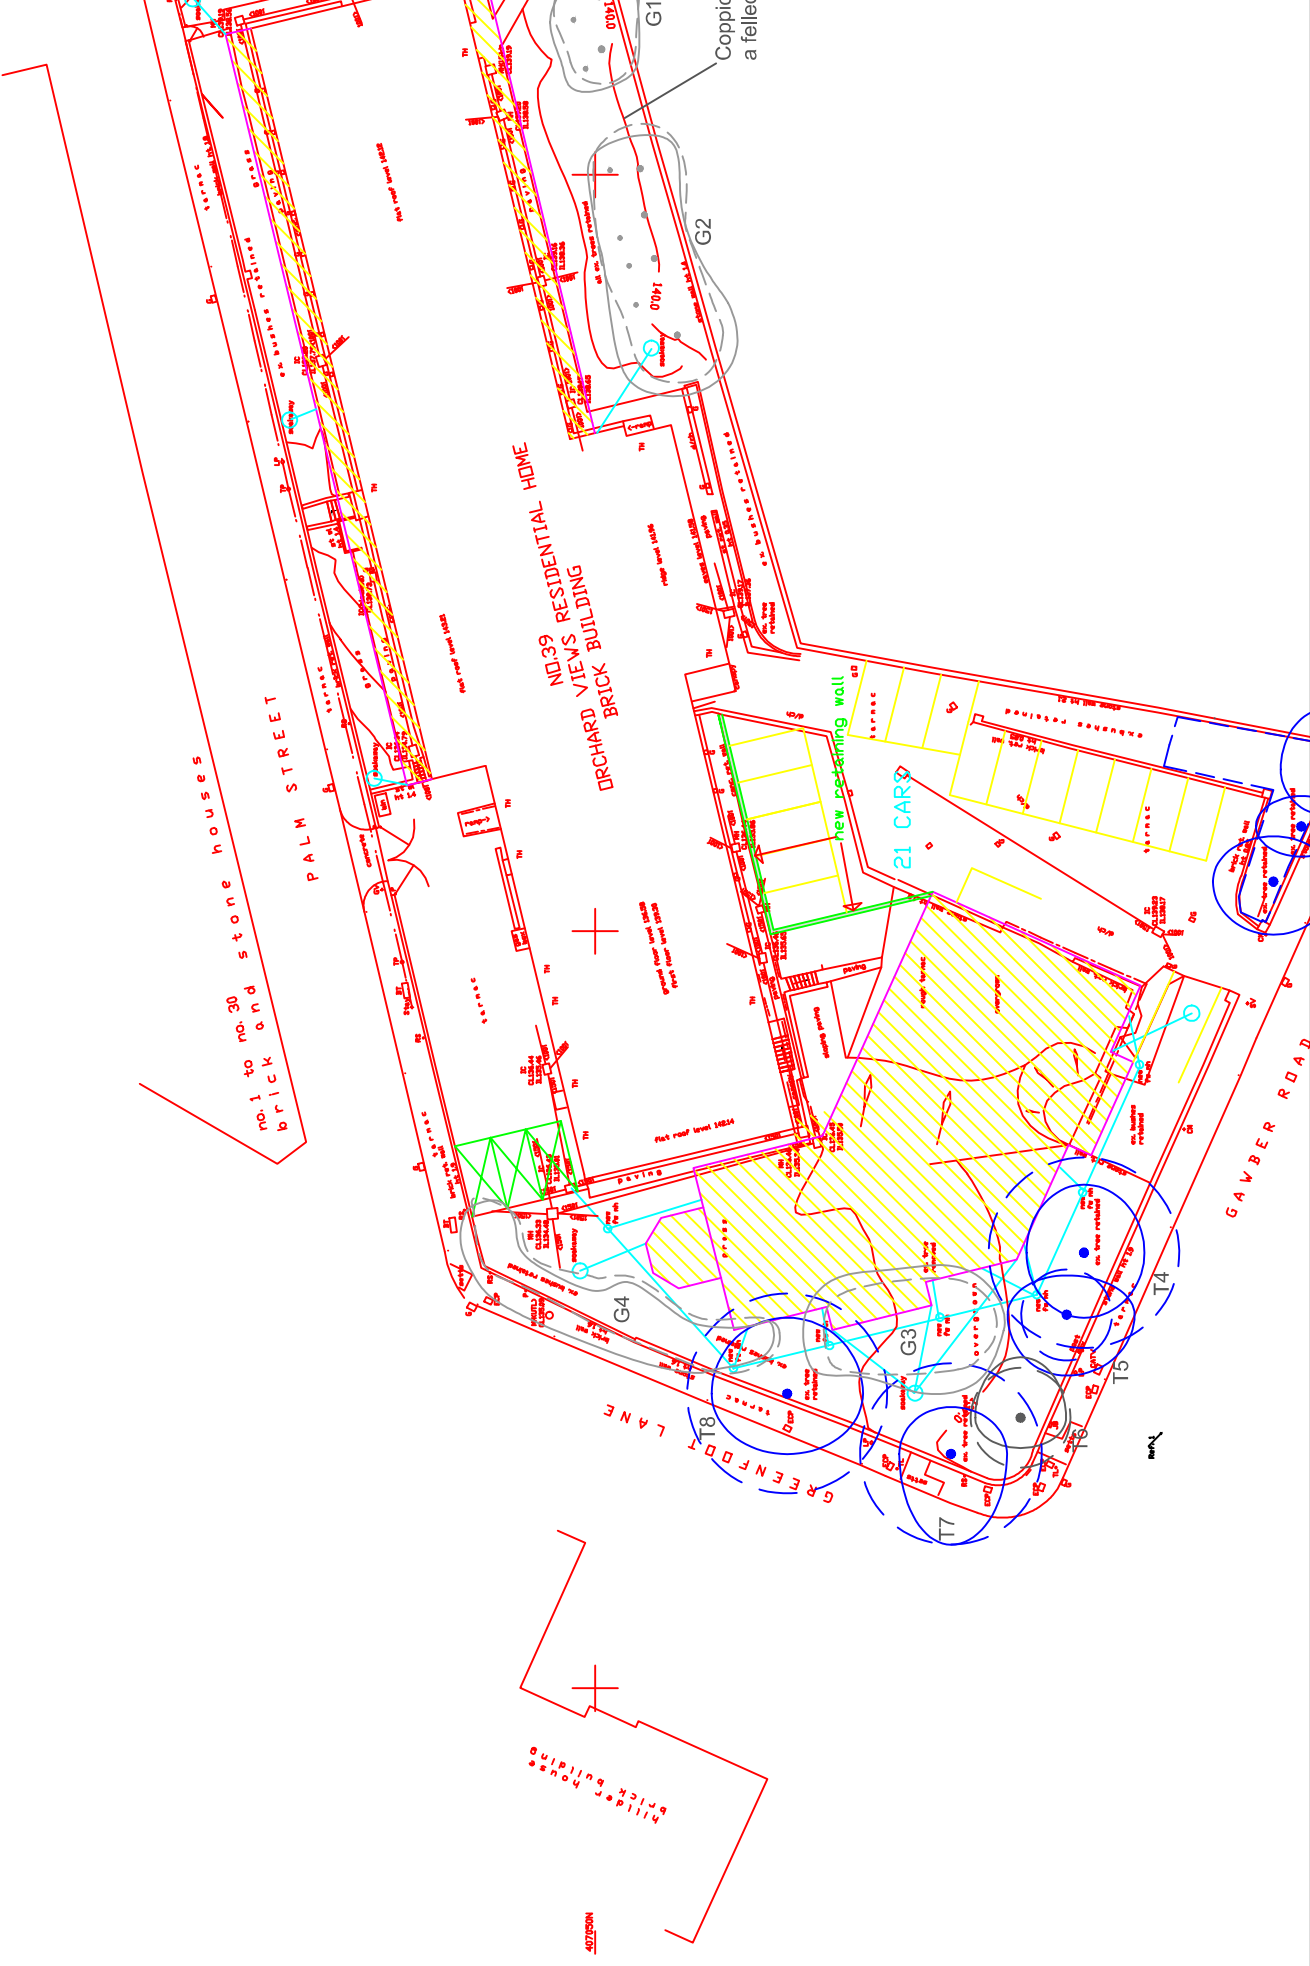

no. 1 to no. 30
brick and stone houses

PALM STREET

NO. 39 RESIDENTIAL HOME
ORCHARD VIEWS
BRICK BUILDING

Copper
a feller

new retaining wall


21 CARS

GAWBER ROAD

GREENFOOT LANE

Hilder House
Brick Building

407250N

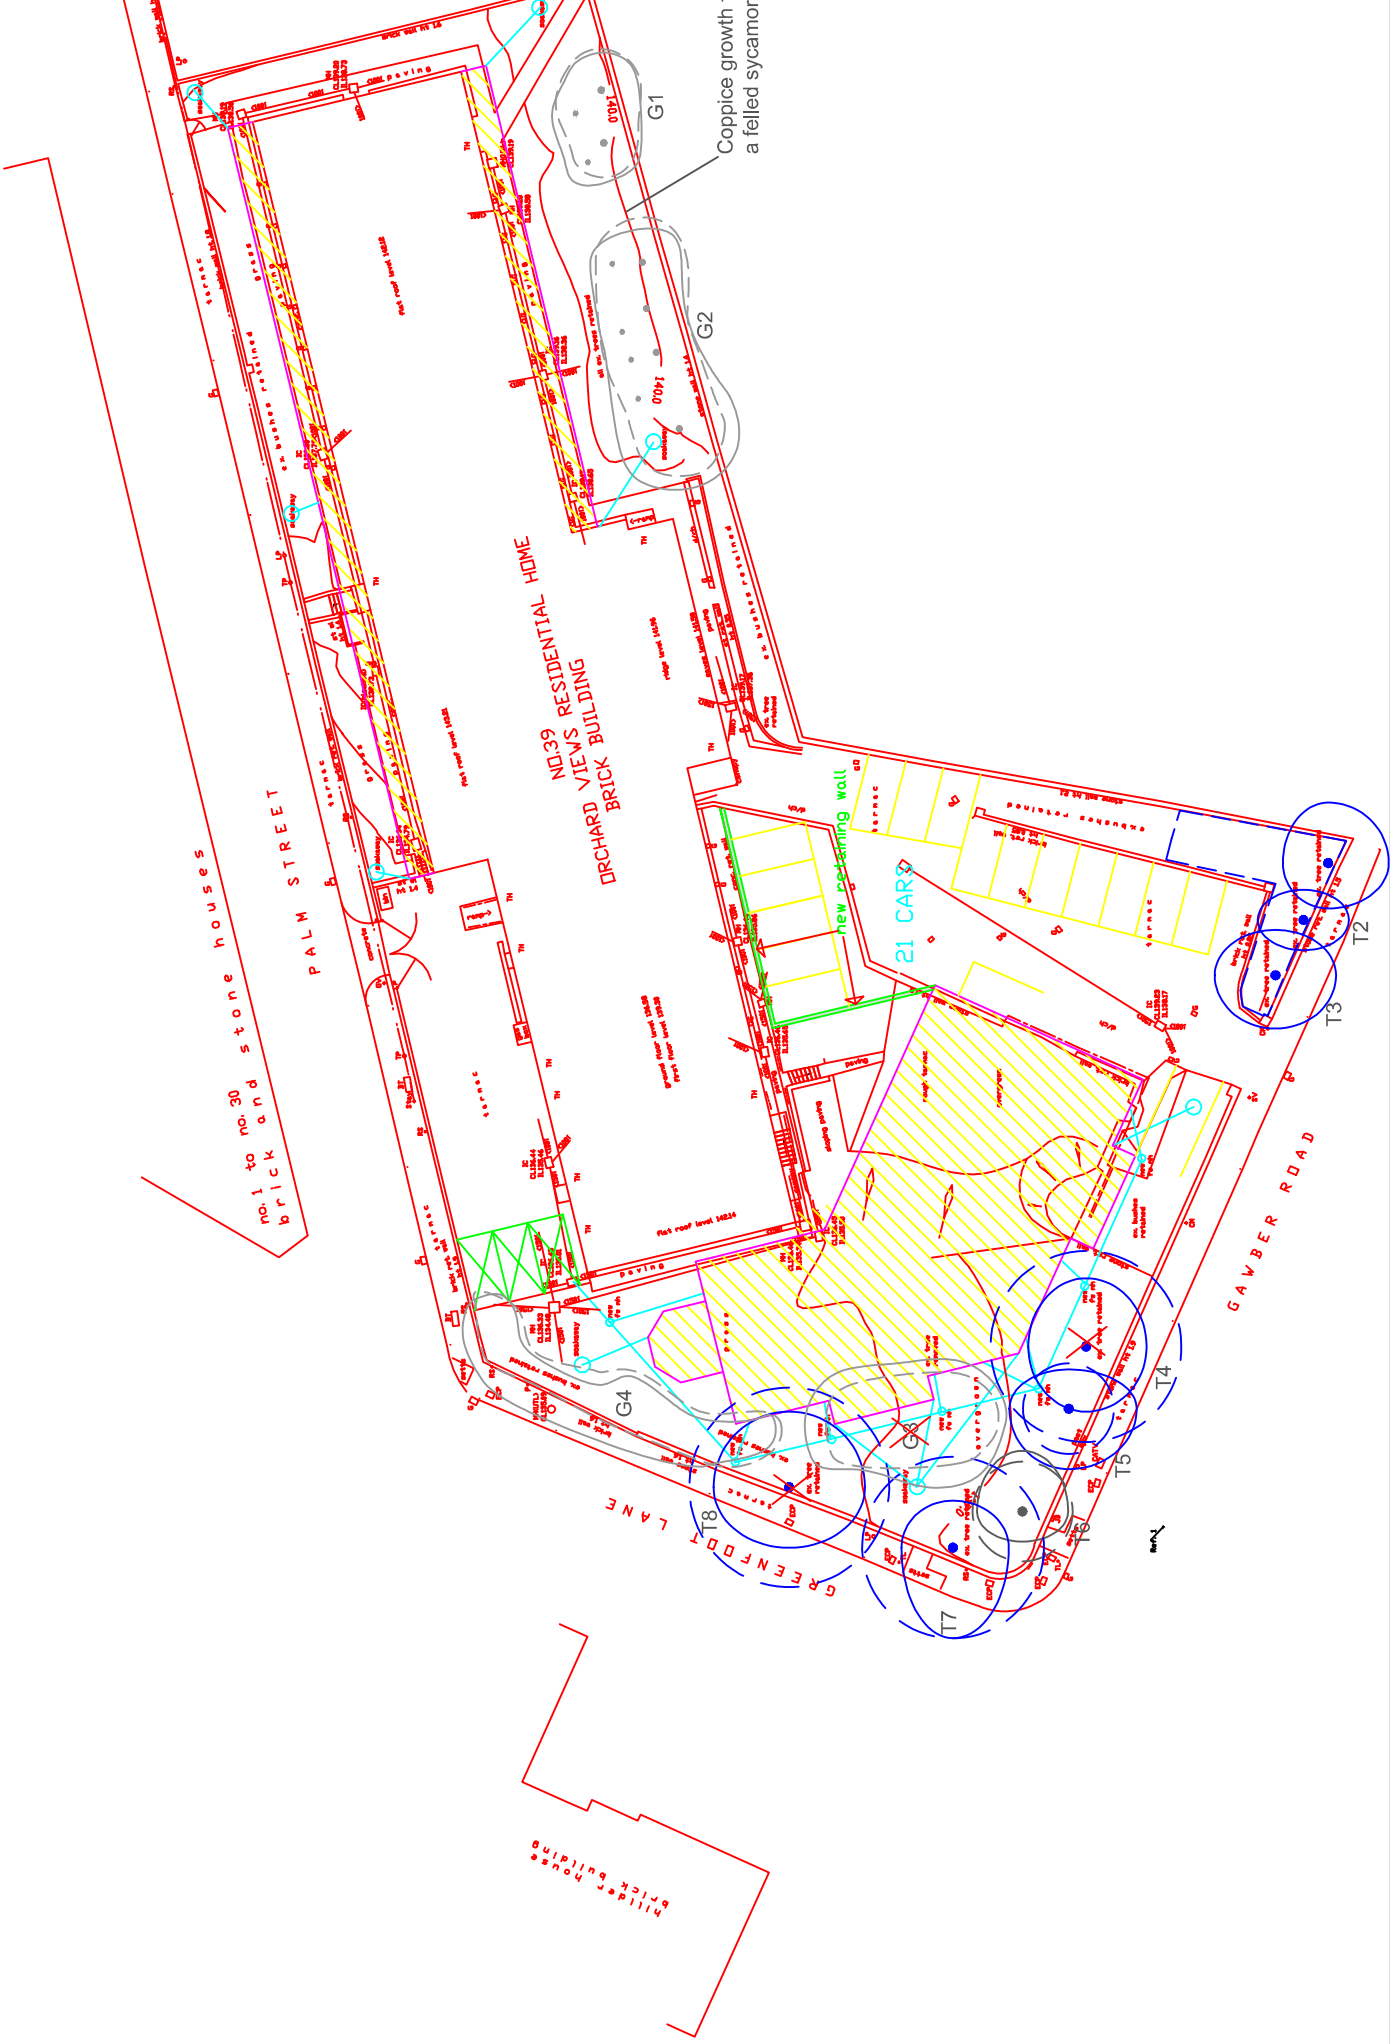

Child houses
brick building

no. 1 to no. 30
brick and stone houses

Coppice growth
a felled sycamore

NO. 39 RESIDENTIAL HOME
DERCHARD VIEWS BRICK BUILDING

21 CARS

new retaining wall

GABBER ROAD

PALM STREET

GREENFORD LANE

Appendix 1

The Experience and Qualifications of Ian Kennedy

1. Qualifications

Ian graduated from the Scottish Agricultural College in August 1995 with a Higher National Diploma in Horticulture (HND) with Distinction.

In 1998 Ian graduated from the University of Aberdeen with a BSc (Hons) Upper second class in Forestry with Arboriculture and Amenity Forestry.

He passed the LANTRA Professional Tree Inspection examination in (2006).

In 2009 his application to become a professional member of the Arboricultural Association was assessed to fulfil all the necessary requirements and he became a professional member of the Association that year.

In 2011 he passed the final examination of the Institute of Chartered Foresters and became a member of that institute in January 2012.

2. Practical experience

Presently Ian is working in private practice as an independent arboricultural and woodland management consultant undertaking tree conditions surveys, pre-development tree surveys to the BS5837:2012 standard, mortgage reports and woodland management planning works. Clients range from home owners and farmers to architects, building companies, local authorities, schools and larger development companies.

Prior to private practice Ian held a number of positions in local government. Firstly he was the arboriculturalist within a planning office in Essex. Ian gained considerable experience regarding trees in relation to development, in particular BS 5837.

Development work formed the core of his duties and applications ranged from small back garden developments to major schemes such as the redevelopment of Ministry of Defence land for private residential development. Ian also undertook all functions associated with Tree Preservation Orders (TPOs), including the making of new TPOs, assessing suitability of applications to work on protected trees and trees in conservation areas.

Ian went on to manage a 500 hectare woodland estate for a local authority in South Yorkshire that included a mix of urban and rural woodlands. This included preparation and implementation of detailed management plans for multiple use woodlands. He undertook all aspects of silvicultural management from marking to contract tendering and monitoring. He also managed the access, conservation, landscape and archaeological requirements of the estate.

Ian was directly involved in the estate achieving Forest Stewardship Council certification in 2003 and personally ensured continued certification.

Ian has worked extensively with Forestry Commission to obtain the necessary licences for management works and ensured the estate benefited fully from the full range of grants available.

Latterly at the same authority Ian went on to manage the trees and woodlands unit, having overall responsibility for management of the authority's tree and woodland stock and associated staff, together with delivery of other tree related services such as those associated with the Town and Country Planning Acts.

3. Continuing professional development

Ian regularly attends meetings, seminars and training events hosted by The Arboricultural Association, Institute of Chartered Foresters, Royal Forestry Society and Forestry Commission and benefits from the respective journals, briefings and newsletters available to members of the first three of the organisations listed.

4. Relevant experience

Ian Kennedy has spent 20 years working with trees, including as the arboricultural advisor to planning officers for a Local Planning Authority and manager of a trees and woodlands unit for another local authority with overall responsibility for trees, including in relation to the Town and Country Planning Acts.

Appendix 2

Tree Retention Categories

Category and definition	Criteria (including subcategories where appropriate)	Identification on plan
<p>Table 1 Cascade chart for tree quality assessment</p>		
<p>Trees unsuitable for retention (see Note)</p> <p>Category U</p> <ul style="list-style-type: none"> Trees that have a serious, irreparable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality <p><i>NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7.</i></p>		
<p>Trees to be considered for retention</p> <p>Category A</p> <p>Trees of high quality with an estimated remaining life expectancy of at least 40 years</p> <p>Category B</p> <p>Trees of moderate quality with an estimated remaining life expectancy of at least 20 years</p> <p>Category C</p> <p>Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm</p>		
<p>1 Mainly arboricultural qualities</p> <p>Trees that are particularly good examples of their species, especially if are or unusual; or those that are essential components of growth form or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)</p> <p>Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation</p>		
<p>2 Mainly landscape qualities</p> <p>Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features</p> <p>Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality</p>		
<p>3 Mainly cultural values, including conservation</p> <p>Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)</p> <p>Trees with material conservation or other cultural value</p>		
<p>Trees with no material conservation or other cultural value</p>		

Appendix 3

Explanatory notes for some of the terms used in this report

- **Stem Diameter:** The diameter of the trunk at 1.5m above ground level and recorded in millimetres measured with a diameter tape.
- **Compass Bearing:** N = north; S = south; E = east; W = west;
- **Life Stage:** Assessed as either:
 - Semi-mature = a size which could be easily transplanted;
 - Juvenile mature = prior to seed bearing age and could be transplanted with care;
 - Young Mature = early maturity, not fully grown but of seed bearing age and may have achieved mature height;
 - Mature = fully grown, annual growth is much reduced;
 - Old Mature = old for the species, possibly starting to decline;
 - Veteran = Beyond maturity for the species. This can be characterised by larger than average stem diameters, scaffold branches or crown spreads. Often still growing with full crowns.
 - Ancient = Well beyond normal mature age. It will have special characteristics associated with its age, including biological, cultural. Growth rates will significantly reduced and the tree may be declining in size.
- **Estimated size: #**
- **Health:**
 - Normal Vitality = normal growth and twig extension;
 - Moderate Vitality = reduced twig extension but other than that few signs of ill-health;
 - Early Decline = reduced twig extension and some dead twigs in the outer canopy;
 - Mid-decline = small internodes, the canopy may be thinning and contain dead twigs and/or branches in the outer canopy, older branch wounds that haven't occluded may be decaying and forming cavities;
 - Severe Decline = sparse crown, numerous dead twigs and branches in the outer canopy, older branch wounds likely to be decaying and forming cavities;
 - Dead.
- **Structural Condition**
 - Acute stem union = a weak union between two or more stems at the main forking point caused by the formation of reaction wood. Mechanical pressure at the forking point increases as secondary thickening occurs increasing the risk of failure at that point.


- Acute branch union = the same principle as acute stem unions but between a stem and a branch or two branches rather than 2 main stems.

- **Estimated life**
 - The life expectancy brackets of <10 years, 10+ years, 20+ years and 40+ years accord with the guidance in BS5837:2012 and should be considered as the useful life expectancy in the location the trees are growing in. For example, a tree with significant defects growing in a quiet area could be retained for longer than a tree growing next to a busy highway or a residential building.

- **Amenity**
 - High = Growing in a place that is very publicly visible such as a next to a busy road or places where people gather. The tree is also likely to be large or very large.
 - Medium = A smaller tree growing in a very publicly visible place or a large tree growing in a place with reduced public access.
 - Low = A small to medium sized tree growing in a quiet location where it is barely or not visible to anyone other than the landowner.

Appendix 4

Suggested Tree Protection Fencing taken from BS5837:2012

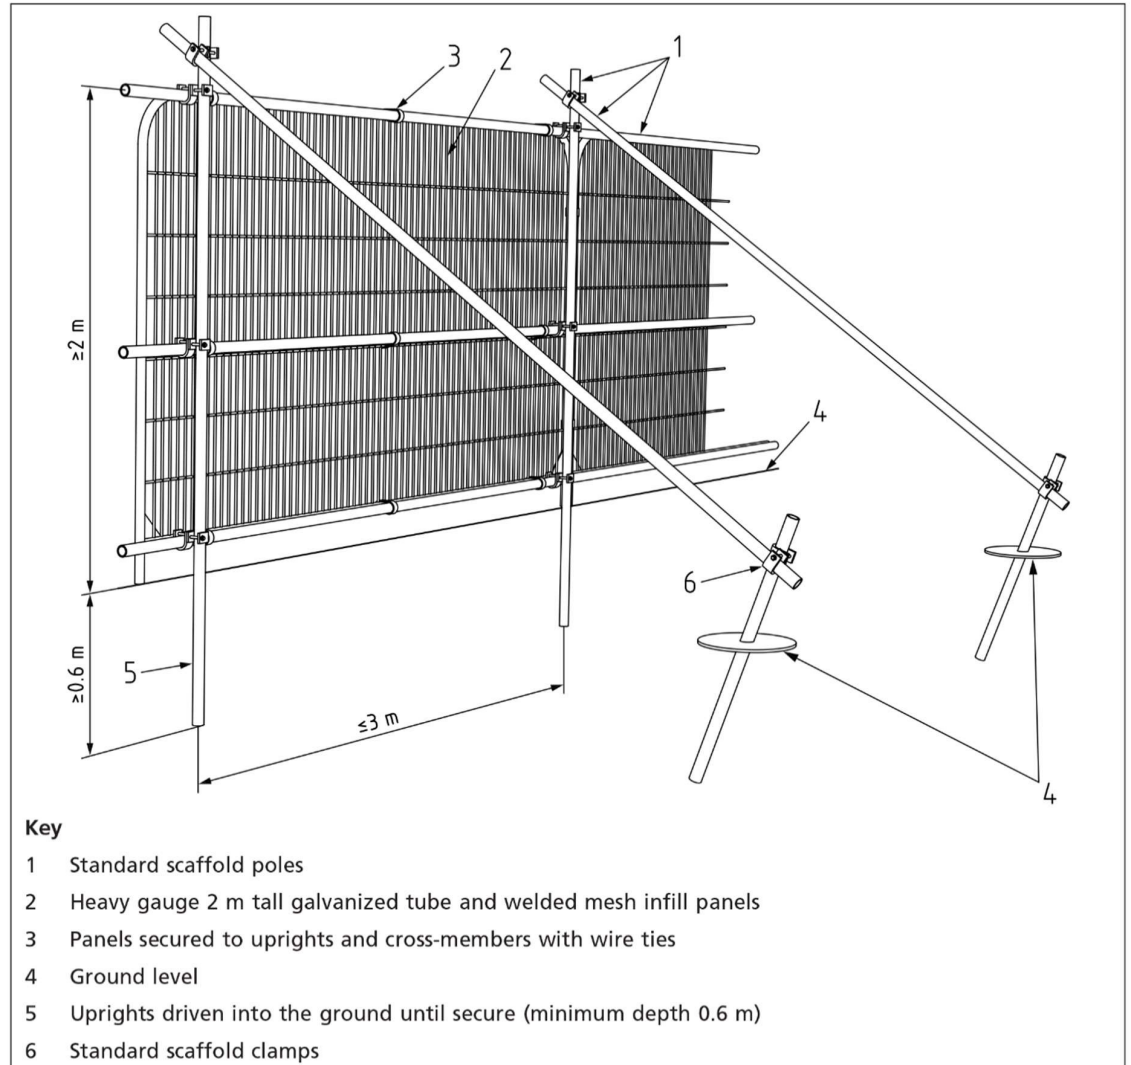


Braced Heras fencings can be used as an alternative to a scaffold frame

BRITISH STANDARD

BS 5837:2012

Figure 3 Examples of above-ground stabilizing systems

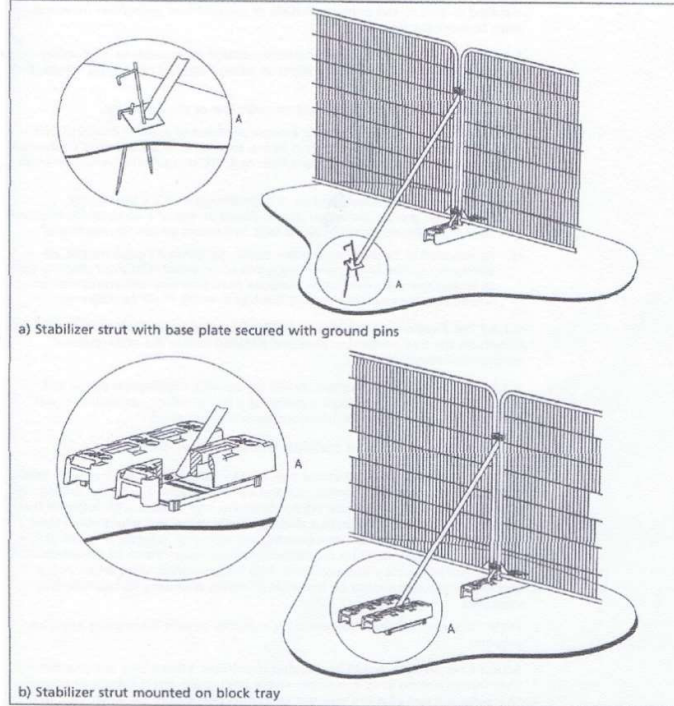

Appendix 5

Example of a sign to attach to tree protective fencing



Ian Kennedy
Wharcliffe Trees and Woodland Consultancy
16 Hartcliffe View
Thurgoland
Sheffield
S35 7BD

0114 288 5501
07891 488303

info@wharcliffetwc.co.uk