

**Proposed Community Hall  
Off Beacon Close  
Silkstone Common**

**Phase 2  
Pre-development Arboricultural Report**

**Prepared at the request of  
Peter Thompson Architect**

**19 August 2024**

**By  
Ian Kennedy  
Wharnccliffe Trees and Woodland Consultancy**

All rights in this report are reserved. No part of it may be reproduced or transmitted, in any form or by any means, electronic, mechanical, recording or otherwise, or stored in any retrieval system of any nature, without written permission. Its content and format are for the exclusive use of the addressee in respect of this site. It may not be sold, lent, hired out or divulged to any third party not directly involved in this site without written consent.

## Summary

I have been instructed to carry out a pre-development survey of the trees growing on and around the site of the former community hall in Silkstone Common. There are proposals to build a new hall in the same location as the last hall that has been demolished.

The approximate locations of the tree, their crown spreads and root protection areas are recorded on Plan 1 that shows a currently vacant site.

Table 1 records their species, dimensions, age, life expectancy, any defects, their amenity value and habitat potential. This information was collected, interpreted and recorded in accordance with BS5837:2012 *Trees in relation to design, demolition and construction – Recommendations*. The information is used to attribute retention categories to the trees; A, B, C and U. These retention categories are described in Appendix 2.

There are four large sycamore trees growing around the edge of the site, both within it and outside it. These are prominent trees in good health and condition. They are included in the second highest retention category B.

There are two conifer trees within the interior of the site. These have lower value and are included in the lowest retention category C.

Plan 2 shows the proposed layout of the new building with the crown spreads and root protection areas plotted. The new hall is proposed within the footprint of the old hall.

Section 4 of the report is the impact assessment that discusses the impact of the proposed development on the trees.

The new hall would be in very close proximity to Trees 5 and 6, two sycamores. However, the new building is proposed within the footprint of the previous building. Provided no additional excavations are required beyond the footprint of the original building there will be no detrimental impact on these trees. Some minor crown lifting to Tree 5 might be required to accommodate the new building.

None of the other trees included in this report would be impacted by the development.

# CONTENTS

---

<b>1</b>	<b>INTRODUCTION.....</b>	<b>6</b>
1.1	Instruction.....	6
1.2	Documents and Provided Information.....	6
1.3	Limitations.....	6
<b>2</b>	<b>SITE VISIT AND OBSERVATIONS .....</b>	<b>7</b>
2.1	Site visit.....	7
2.2	Brief Site description.....	7
2.3	Development Proposals.....	7
2.4	Locations of the Trees .....	7
2.5	Tree observations .....	8
<b>3</b>	<b>Interpretation of Information and References.....</b>	<b>10</b>
3.1	BS5837:2012 Tree Retention Categories .....	10
3.2	Below Ground Constraints; Root Protection Areas (RPAs).....	10
3.3	Above Ground Constraints; Crown Spreads .....	11
3.4	Conception and Design.....	11
<b>4</b>	<b>ARBORICULTURAL IMPACT ASSESSMENT .....</b>	<b>12</b>
4.1	Arboricultural Impact Assessment.....	12
<b>5</b>	<b>REFERENCES, PLANNING POLICY AND GUIDANCE.....</b>	<b>13</b>
5.1	National policy .....	13
5.2	British Standard: Trees in relation to design, demolition and construction – Recommendations (BS 5837, 2012).....	14
5.3	Barnsley Metropolitan Borough Council.....	14
<b>6</b>	<b>LEGAL CONSIDERATIONS.....</b>	<b>15</b>
6.1	Protected trees .....	15
6.2	Wildlife conservation legislation .....	15

# TABLES

---

Table 1	The Tree Survey.....	8
---------	----------------------	---

# PLANS

---

Plan 1	Tree constraints plan of the existing site layout.....	16
Plan 2	Tree constraints plan of the proposed site layout.....	17

# APPENDICES

---

Appendix 1	The Experience and Qualifications of Ian Kennedy .....	18
Appendix 2	Tree Retention Categories .....	20
Appendix 3	Explanatory notes for some of the terms used in this report.....	21

# 1 INTRODUCTION

## 1.1 Instruction

I have been instructed by Peter Thompson, Architect to carry out a pre-development survey of the trees growing within and close to the site of the former community hall in Silkstone Common.

A new community hall is proposed within the same footprint as the former hall.

The tree survey is intended to provide a structured, impartial assessment of the tree population that could be affected by a proposed development.

The survey is intended to be informative to all stages of the development process and was carried out in accordance with *BS5837: 2012 Trees in relation to design, demolition and construction – Recommendations*.

## 1.2 Documents and Provided Information

I was provided with the following documents:

A site plan showing the proposed position of the new community hall. Revision C.

## 1.3 Limitations

This report is concerned only with assessing the condition of the trees, their importance in the local landscape and any cultural and conservation values.

It takes no account of the affects the trees may have on the soil, such as heave where trees are removed or shrinkage where trees are retained.

Trees are dynamic organisms influenced by weather, pests and diseases. Therefore, this report can only remain valid for a period of 24 months.

Any works around the trees such as trenching, pruning, storage of materials and trafficking that has not first been approved by a suitably qualified arboriculturalist will invalidate this report.

This report has been prepared for pre-development purposes. Whilst the condition of the trees has been assessed this is primarily to attribute a retention category. It is not a tree condition and safety report and may not include the same level of detail on tree health and structural condition.

No decay detection equipment was used to gather information on the condition of the trees.

All survey and inspection was completed at ground level.

## **2 SITE VISIT AND OBSERVATIONS**

### **2.1 Site visit**

I visited the site on 15 August 2024 to complete the survey.

All dimensions were taken using recognised methodology and arboricultural measuring equipment, unless otherwise stated.

The principles of BS5837:2012 were applied to the assessment and evaluation of the trees.

### **2.2 Brief Site description**

The site is located to the west of Beacon Close and north of Ben Bank Road close to the northern edge of Silkstone Common. The site is currently vacant following demolition of the previous building.

The trees are growing close to the northern and southern site boundaries. Some of the trees are growing outside the site, including one which is on Network Rail land.

### **2.3 Development Proposals**

The development proposes a new single storey community hall to be constructed in the same location as the previous building.

### **2.4 Locations of the Trees**

The positions of the trees were plotted by me using fixed known points. The positions of the trees are believed to be sufficiently accurate for the purposes of this report.

## 2.5 Tree observations

Table 1. The Tree Survey

Tree number	Species	Height (M)	Stem diameter (DBH in MM)	Branch spread (M)	Ht of canopy above the site (M)	Life stage	Health	General observations on the tree's condition	Estimated life in years	Amenity value	Habitat value	Category
T1	Sycamore	18.0	650, 650, 600, 500#	North – 6.0# South – 7.5 East – 6.2 West – 6.0	1.5 over site	Mature	Normal	A large, prominent and healthy tree growing on neighbouring Network Rail land.	20+	Medium	Low	B 1
T2	Leyland cypress	13.0	600	North – 1.0 South – 3.0 East – 2.5 West – 3.0	1.5	Young mature	Normal	A healthy but unimportant tree.  There are a number of acute branch unions. These are typical in the species.	20+	Low	Low	C 1
T3	Norway spruce	15.0	400	North – 3.0 South – 3.0 East – 3.0 West – 3.5	GL	Juvenile mature	Moderate	A relatively young and healthy tree. The tree will have increasing value as it matures.	20+	Medium	Low	C 1
T4	Sycamore	17.0	800	North – 2.6 South – 10.5 East – 7.6 West – 5.3	GL	Mature	Normal	A large, prominent and healthy tree. There is an acute stem union at 1m. This was stable at the time of inspection.	20+	Medium	Low	B 1
T5	Sycamore	18.0	460#	North – 7.0 South – 7.0# East – 3.0 West – 5.5	2.0 over site	Mature	Normal	A large, prominent and healthy tree with no significant defects. The crown extends over the proposed building area.	20+	Medium	Low	B 1&2



Tree number	Species	Height (M)	Stem diameter (DBH in MM)	Branch spread (M)	Ht of canopy above the site (M)	Life stage	Health	General observations on the tree's condition	Estimated life in years	Amenity value	Habitat value	Category
T6	Sycamore	18.0	700#	North – 7.0 South – 7.0# East – 6.0 West – 3.0	5.0 over site	Mature	Normal	A large, prominent and healthy tree with no significant defects.	20+	Medium	Low	B 1&2

### 3 Interpretation of Information and References

My interpretation and appraisal of information gathered from the survey is based on experience of tree species, visual risk hazard assessment and the guidance set out in BS5837:2012 *Trees in Relation to Design, Demolition, Construction – Recommendations*.

#### 3.1 BS5837:2012 Tree Retention Categories

All trees have been assessed and assigned a retention category in accordance with Table 1 of the standard. A copy of Table 1 from BS5837: 2012 is included as Appendix 2.

This categorisation is intended to rank trees according to their importance in terms of quality, health, life expectancy, amenity and landscape value, together with wildlife and cultural importance. This ranking assists in determining the suitability and appropriateness of trees for retention in any development. Categories A to C are those considered for retention, 'A' being highest.

Category A and B trees tend to be considered more valuable for retention than category C trees.

Category 'U' trees are those not suitable for retention because of impaired condition.

Hedges and shrubs are not assigned retention categories but their heights and species are simply noted on the tree constraints plan.

#### 3.2 Below Ground Constraints; Root Protection Areas (RPAs)

The root protection area is the area of land considered necessary for trees should they be retained as part of any development. This is calculated using the stem diameter measured at 1.5 metres from ground level. This protection area is shown diagrammatically as a circle centred on the base of the tree where it is expected that rooting has not been impeded in any one direction and where disturbance has not taken place. Where rooting has been impeded or disturbance taken place then the shape and size of the root protection area is modified according to an assessment of where rooting is likely to take place.

Where trees are to be retained, it is optimal to locate structures and services outside the RPA. However, where incursion becomes necessary, technical solutions may be possible to limit damage, areas lost can be compensated elsewhere, or the soil environment can be improved. In these circumstances an arboricultural method statement will be necessary to ensure that works are undertaken sympathetically and do not damage the below ground parts of the trees.

### **3.3 Above Ground Constraints; Crown Spreads**

Ideally, working areas will be out with the crown spreads of trees to be retained.

Any permanent development proposed within the canopy spread of a tree should be assessed to determine whether the level of pruning necessary to accommodate the layout would be acceptable. However, the effects of shade and other perceived inconveniences of trees this close to property should also be considered, together with the future growth potential of the trees and the maintenance obligation this will bring.

Where temporary access by high sided vehicles and machinery for construction or erection of scaffolding is necessary within the crown spreads of trees to facilitate development an arboricultural method statement will be necessary to ensure pruning works are carried out sympathetically prior to demolition or construction works commencing.

### **3.4 Conception and Design**

The constraints imposed by trees should assist with site design and layout, together with the other competing needs of development.

The provisions of services and the access space required for construction itself should be considered.

## 4 ARBORICULTURAL IMPACT ASSESSMENT

This section of the report considers the impact that the proposed layout could have on the trees that are included in Table 1 and shown on Plan 1; *Tree Constraints Plan showing the existing layout*.

This section discusses the engineering solutions that may be available to retain trees where development is proposed within their root protection areas (RPAs) or the pruning options available where development might affect crown spreads.

Where there is no option but to remove a tree to accommodate the proposed layout this section will discuss the impact on amenity and ecology and any mitigation that could be offered such as opportunities for replacement planting.

### 4.1 Arboricultural Impact Assessment

#### Trees 1 to 4

Trees 1 to 4 would be unaffected by the proposed development.

Trees 2 and 3 occupy a relatively large area of the plot without adding a great deal of value to it. The removal of these trees could be considered as part of the development.

#### Trees 5 and 6

The layout in Plan 2 suggests that a significant part of the root protection areas of these trees would be impacted by the development. However, I have been informed that the proposed building would be located on the footprint of the previous building. I have not been provided with any details of the nature and depth of the original foundations and I have not been provided with any details of the foundations for the proposed building. Provided that the foundations for the new building do not require any excavation beyond that of the previous building it is likely that a building could be sited in the proposed location without detriment to the trees.

Some minor pruning may be required to Tree 5 to raise the crown over the building area. This is not just for the building itself but to accommodate the building work. This would involve the removal of small diameter branches to a height of 6m. This is considered minor pruning work and would not be detrimental to the health or amenity of the tree.

## 5 REFERENCES, PLANNING POLICY AND GUIDANCE

### 5.1 National policy

Section 197 in the Town and Country Planning Act 1990 makes it the duty of Local Planning Authorities (LPAs), ‘in the interests of amenity,’ to protect trees, when granting planning permission, either by the imposition of conditions or serving Tree Preservation Orders (TPOs).

The National Planning Policy Framework (NPPF) (2023) mentions trees and should be taken into account.

***136.** Trees make an important contribution to the character and quality of urban environments, and can also help mitigate and adapt to climate change. Planning policies and decisions should ensure that new streets are tree-lined<sup>53</sup>, that opportunities are taken to incorporate trees elsewhere in developments (such as parks and community orchards), that appropriate measures are in place to secure the long-term maintenance of newly-planted trees, and that existing trees are retained wherever possible. Applicants and local planning authorities should work with highways officers and tree officers to ensure that the right trees are planted in the right places, and solutions are found that are compatible with highways standards and the needs of different users.*

***180.** Planning policies and decisions should contribute to and enhance the natural and local environment by:*

*(b) recognising the intrinsic character and beauty of the countryside, and the wider benefits from natural capital and ecosystem services – including the economic and other benefits of the best and most versatile agricultural land, and of trees and woodland;*

***186** When determining planning applications, local planning authorities should apply the following principles: a) if significant harm to biodiversity resulting from a development cannot be avoided (through locating on an alternative site with less harmful impacts), adequately mitigated, or, as a last resort, compensated for, then planning permission should be refused; b) development on land within or outside a Site of Special Scientific Interest, and which is likely to have an adverse effect on it (either individually or in combination with other developments), should not normally be permitted. The only exception is where the benefits of the development in the location proposed clearly outweigh both its likely impact on the features of the site that make it of special scientific interest, and any broader impacts on the national network of Sites of Special Scientific Interest; c) development resulting in the loss or deterioration of irreplaceable habitats (such as ancient woodland and ancient or veteran trees) should be refused, unless there are wholly exceptional reasons<sup>67</sup> and a suitable compensation strategy exists; and d) development whose primary objective is to conserve or enhance biodiversity should be supported; while opportunities to improve biodiversity in and around developments should be integrated as part*

*of their design, especially where this can secure measurable net gains for biodiversity or enhance public access to nature where this is appropriate.*

#### Annex 2: Glossary

*Ancient or veteran tree: A tree which, because of its age, size and condition, is of exceptional biodiversity, cultural or heritage value. All ancient trees are veteran trees. Not all veteran trees are old enough to be ancient, but are old relative to other trees of the same species. Very few trees of any species reach the ancient life-stage.*

*Ancient woodland: An area that has been wooded continuously since at least 1600 AD. It includes ancient semi-natural woodland and plantations on ancient woodland sites (PAWS).*

*Irreplaceable habitat: Habitats which would be technically very difficult (or take a very significant time) to restore, recreate or replace once destroyed, taking into account their age, uniqueness, species diversity or rarity. They include ancient woodland, ancient and veteran trees, blanket bog, limestone pavement, sand dunes, salt marsh and lowland fen.*

## **5.2 British Standard: Trees in relation to design, demolition and construction – Recommendations (BS 5837, 2012)**

The British Standard: *Trees in relation to design, demolition and construction – Recommendations* (BS 5837, 2012) contains guidance on how to assess trees in or close to proposed development and information to include in pre-development arboricultural reportssubmitted with planning applications. Appendices 2 and 3 contain relevant extracts from BS 5837 (2012).

## **5.3 Barnsley Metropolitan Borough Council**

Barnsley Local Plan. Adopted January 2019

17. Green Infrastructure and Green Space

## **6 LEGAL CONSIDERATIONS**

### **6.1 Protected trees**


According to Barnsley Council's online records which were checked on 19 August 2024, none of the trees are protected by a Tree Preservation Order (TPO) and the site is not within a Conservation Area.

### **6.2 Wildlife conservation legislation**

Breeding birds are protected, together with bats and their roosts are, whether their roosts are in use or not.

Consideration should be given to the presence of protected species prior to any proposed tree removal or maintenance. This will include breeding birds, principally between March and August, and bats at any time of year.

Tree surgeons should also be aware of their duties under legislation to protect wildlife and carry out their site assessment and work accordingly.

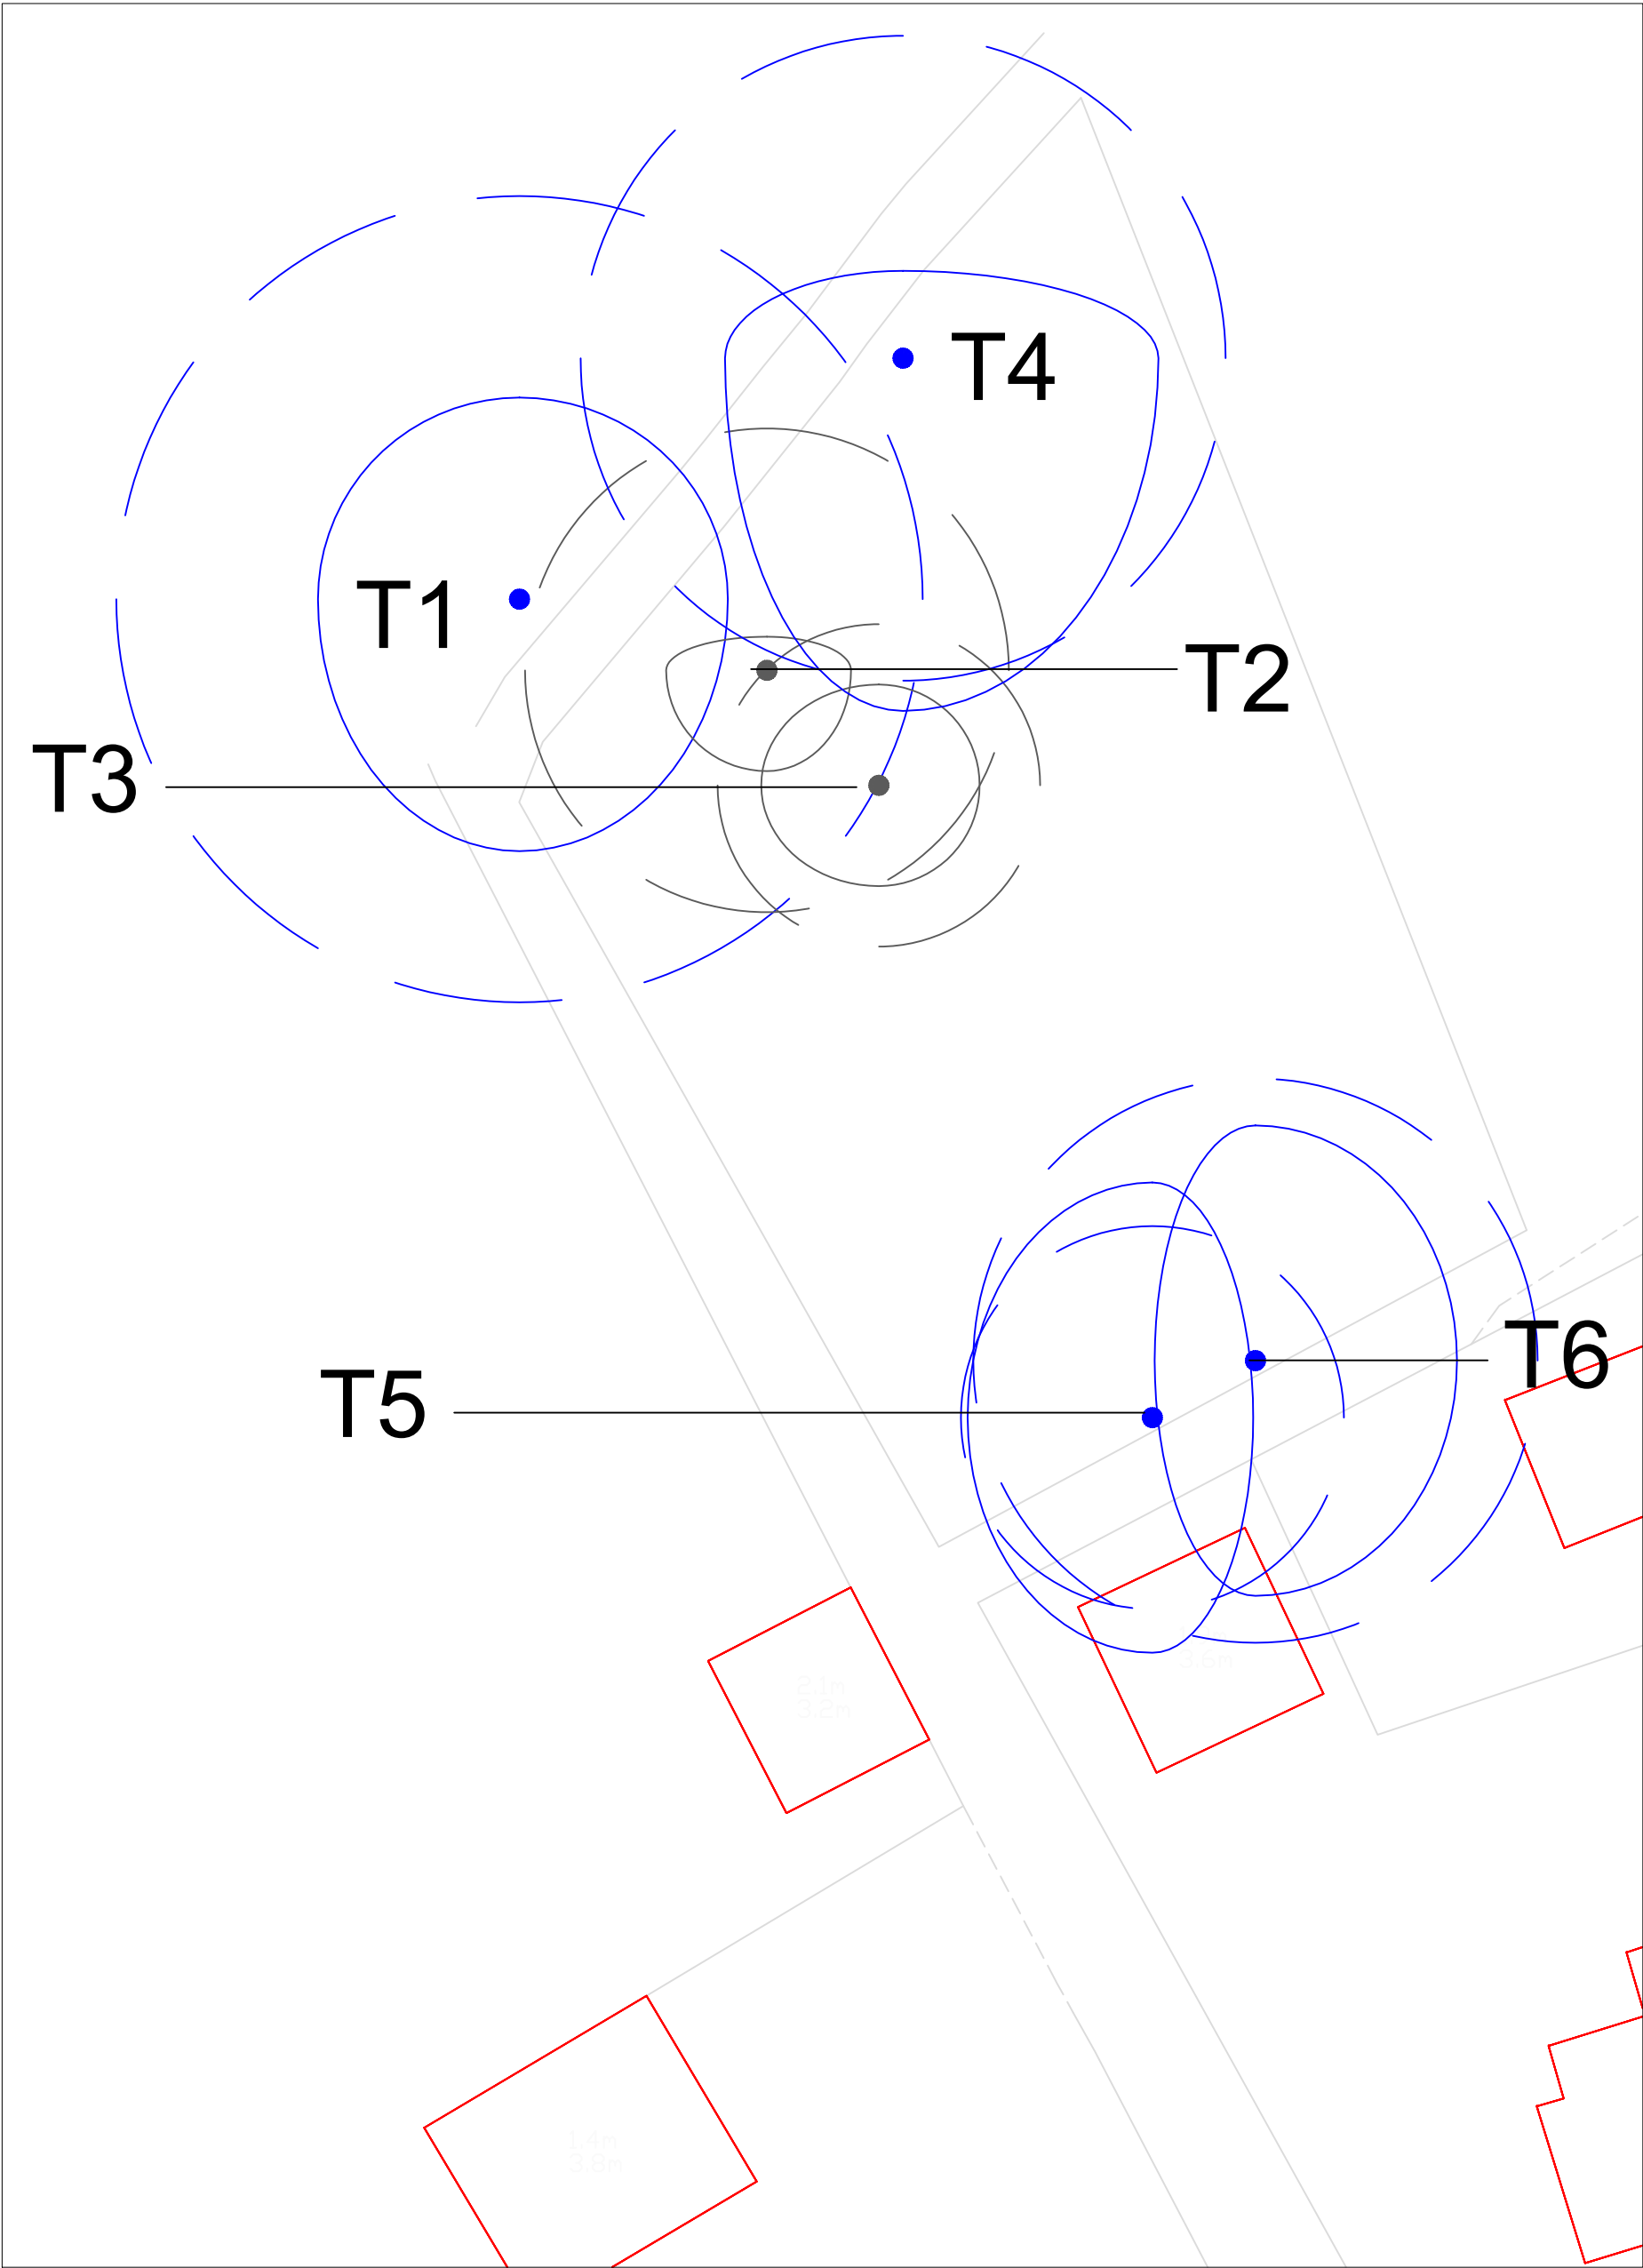


Plan 1 Tree Constraints Plan showing the existing layout

Scale 1:200 @ A3







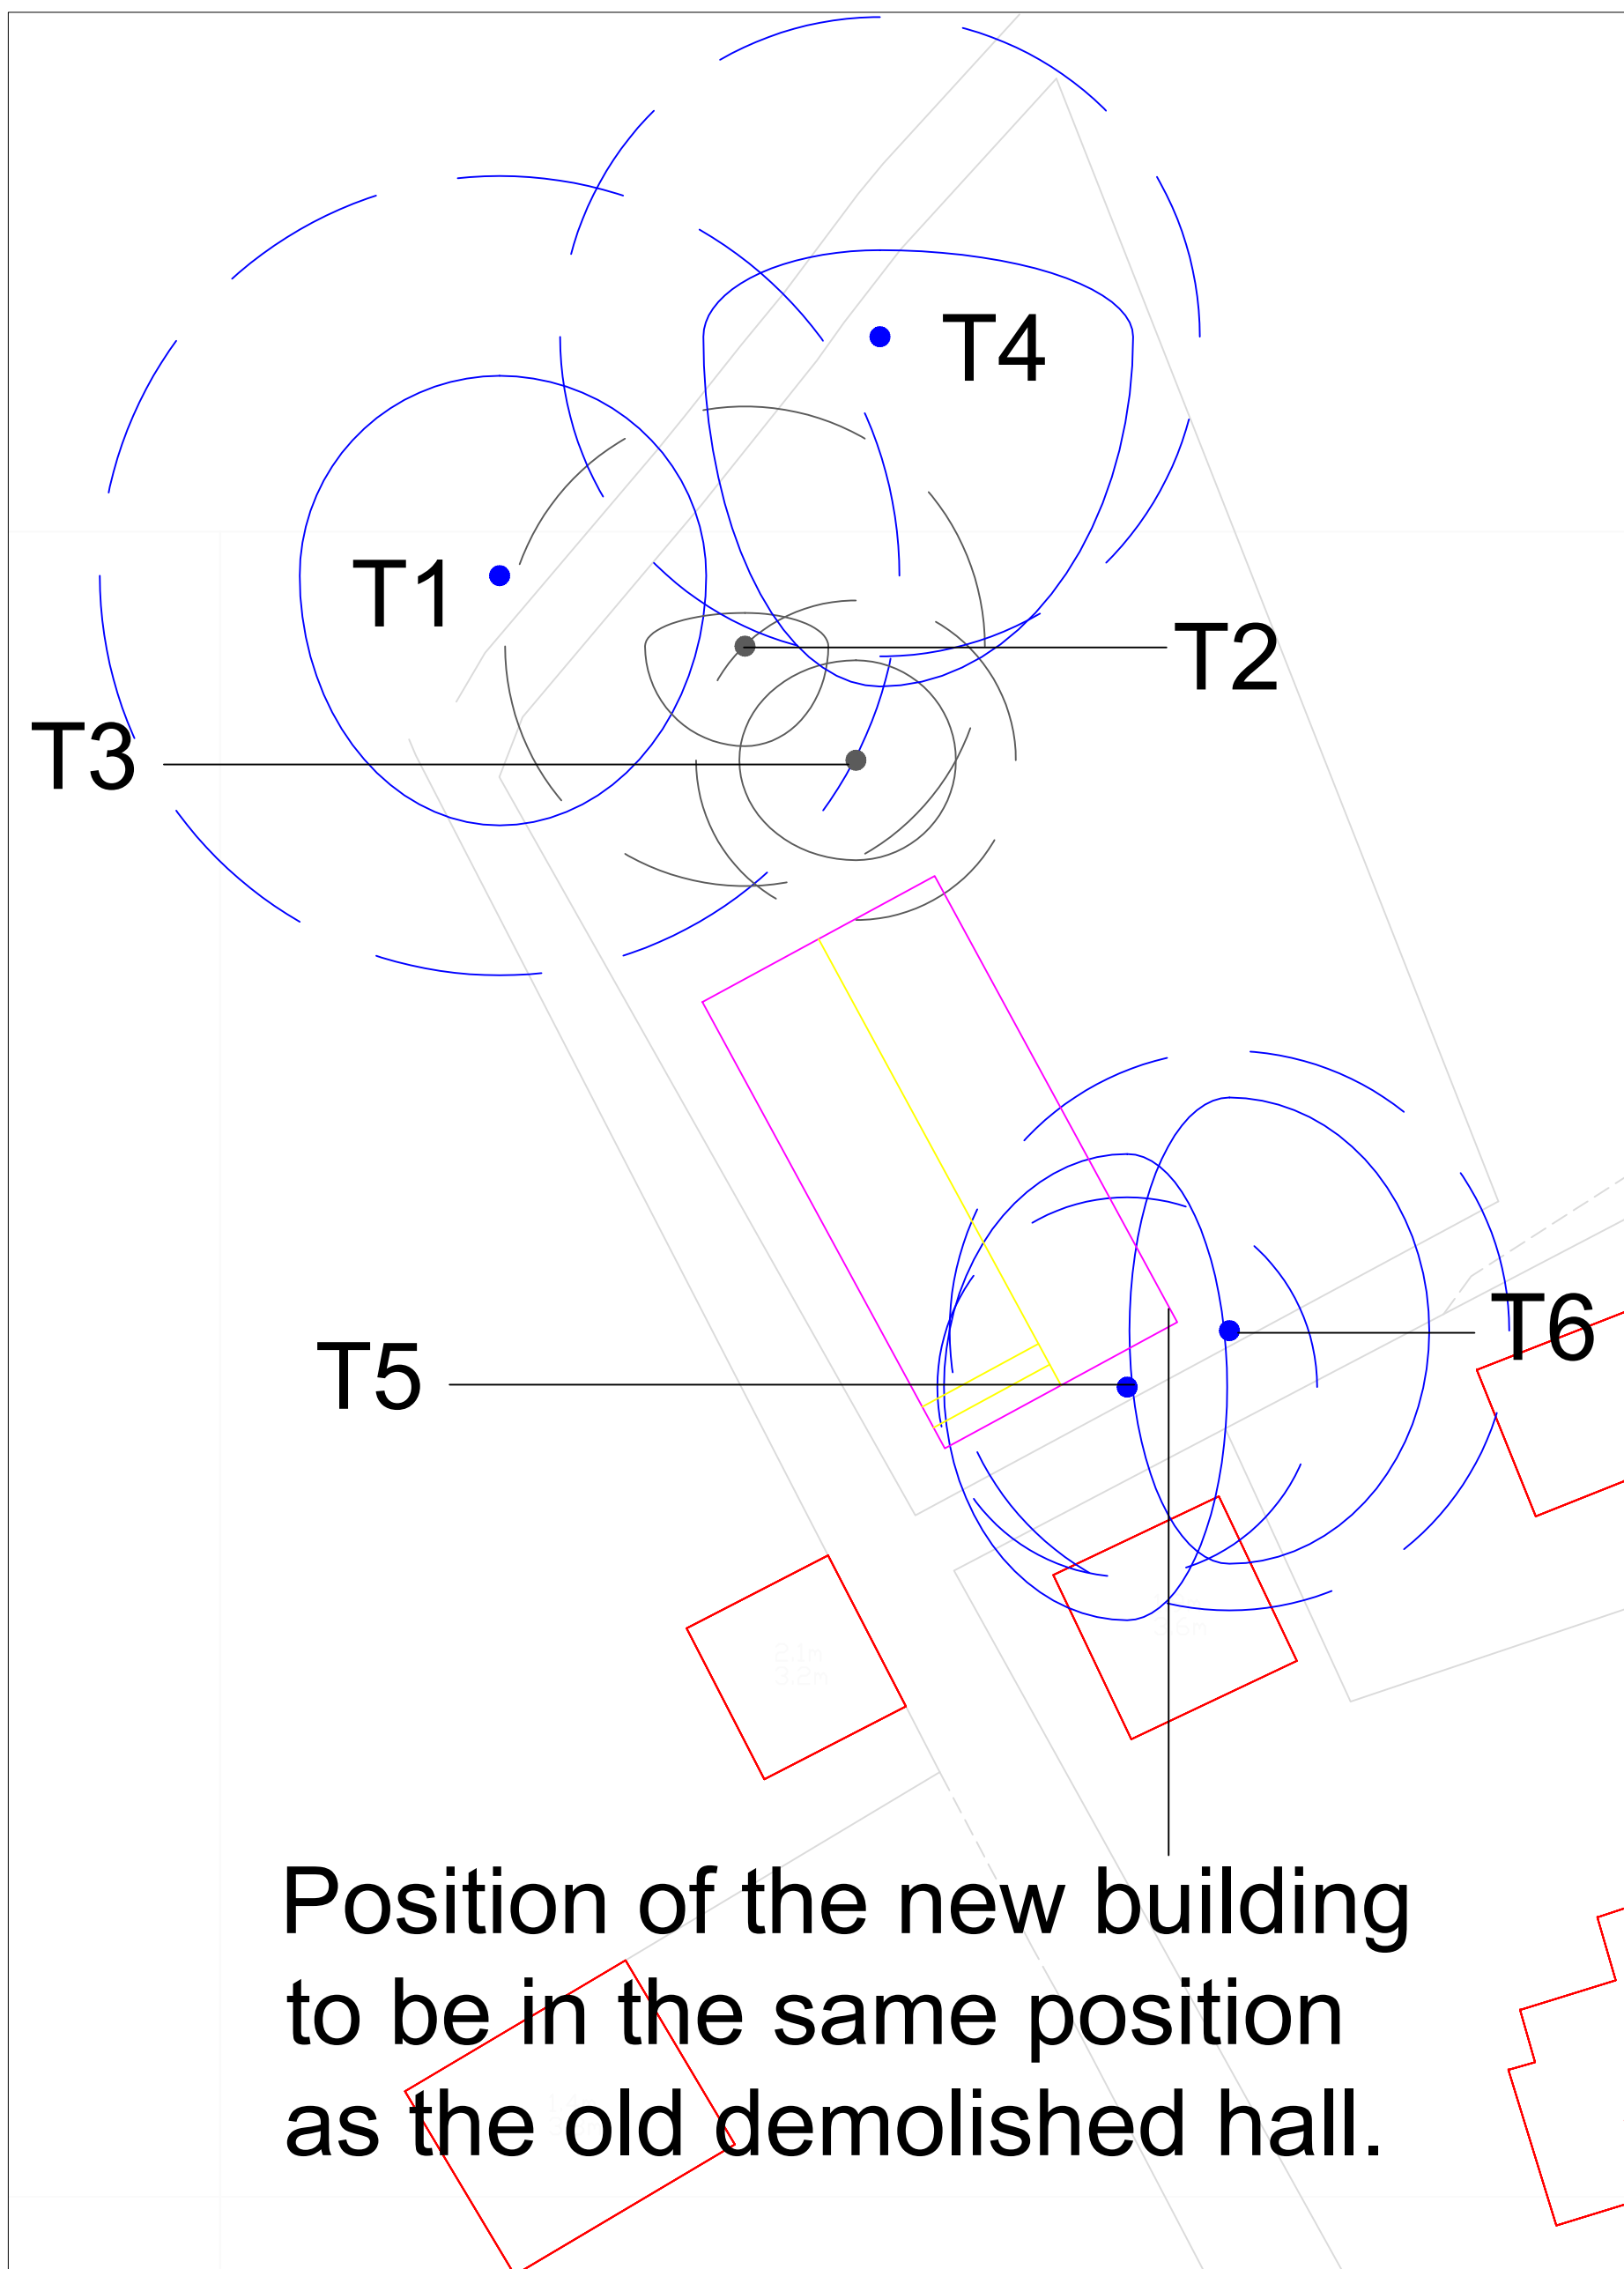

Plan 2 Tree Constraints Plan showing the proposed layout

Scale 1:200 @ A3

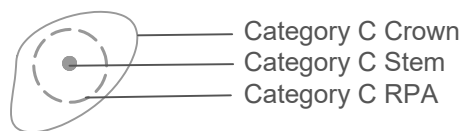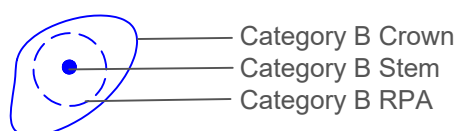

## **Appendix 1**

---

### **The Experience and Qualifications of Ian Kennedy**

#### **1. Qualifications**

Ian graduated from the Scottish Agricultural College in August 1995 with a Higher National Diploma in Horticulture (HND) with Distinction.

In 1998 Ian graduated from the University of Aberdeen with a BSc (Hons) Upper second class in Forestry with Arboriculture and Amenity Forestry.

He passed the LANTRA Professional Tree Inspection examination in (2006).

In 2009 his application to become a professional member of the Arboricultural Association was assessed to fulfil all the necessary requirements and he became a professional member of the Association that year.

In 2011 he passed the final examination of the Institute of Chartered Foresters and become a member of that institute in January 2012.

#### **2. Practical experience**

Presently Ian is working in private practice as an independent arboricultural and woodland management consultant undertaking tree conditions surveys, pre-development tree surveys to the BS5837:2012 standard, mortgage reports and woodland management planning works. Clients range from home owners and farmers to architects, building companies, local authorities, schools and larger development companies.

Prior to private practice Ian held a number of positions in local government. Firstly he was the arboriculturalist within a planning office in Essex. Ian gained considerable experience regarding trees in relation to development, in particular BS 5837.

Development work formed the core of his duties and applications ranged from small back garden developments to major schemes such as the redevelopment of Ministry of Defence land for private residential development. Ian also undertook all functions associated with Tree Preservation Orders (TPOs), including the making of new TPOs, assessing suitability of applications to work on protected trees and trees in conservation areas.

Ian went on to manage a 500 hectare woodland estate for a local authority in South Yorkshire that included a mix of urban and rural woodlands. This included preparation and implementation of detailed management plans for multiple use woodlands. He undertook all aspects of silvicultural management from marking to contract tendering and monitoring. He also managed the access, conservation, landscape and archaeological requirements of the estate.

Ian was directly involved in the estate achieving Forest Stewardship Council certification in 2003 and personally ensured continued certification.

Ian has worked extensively with Forestry Commission to obtain the necessary licences for management works and ensured the estate benefited fully from the full range of grants available.

Latterly at the same authority Ian went on to manage the trees and woodlands unit, having overall responsibility for management of the authority's tree and woodland stock and associated staff, together with delivery of other tree related services such as those associated with the Town and Country Planning Acts.

### **3. Continuing professional development**

Ian regularly attends meetings, seminars and training events hosted by The Arboricultural Association, Institute of Chartered Foresters, Royal Forestry Society and Forestry Commission and benefits from the respective journals, briefings and newsletters available to members of the first three of the organisations listed.

### **4. Relevant experience**

Ian Kennedy has spent 24 years working with trees, including as the arboricultural advisor to planning officers for a Local Planning Authority and manager of a trees and woodlands unit for another local authority with overall responsibility for trees, including in relation to the Town and Country Planning Acts.

## Appendix 2

### Tree Retention Categories

Table 1 Cascade chart for tree quality assessment

Category and definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention (see Note)				
<b>Category U</b> Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	<ul style="list-style-type: none"><li>Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning)</li><li>Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline</li><li>Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality</li></ul> <p><i>NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7.</i></p>			See Table 2
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	
Trees to be considered for retention				
<b>Category A</b> <b>Trees of high quality</b> with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	See Table 2
<b>Category B</b> <b>Trees of moderate quality</b> with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	See Table 2
<b>Category C</b> <b>Trees of low quality</b> with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	See Table 2

## Appendix 3

---

### Explanatory notes for some of the terms used in this report

- **Stem Diameter:** The diameter of the trunk at 1.5m above ground level and recorded in millimetres measured with a diameter tape.
- **Compass Bearing:** N = north; S = south; E = east; W = west;
- **Life Stage:** Assessed as either:
  - Semi-mature = a size which could be easily transplanted;
  - Juvenile mature = prior to seed bearing age and could be transplanted with care;
  - Young Mature = early maturity, not fully grown but of seed bearing age and may have achieved mature height;
  - Mature = fully grown, annual growth is much reduced;
  - Old Mature = old for the species, possibly starting to decline;
  - Veteran = Beyond maturity for the species. This can be characterised by larger than average stem diameters, scaffold branches or crown spreads. Often still growing with full crowns.
  - Ancient = Well beyond normal mature age. It will have special characteristics associated with its age, including biological, cultural. Growth rates will significantly reduced and the tree may be declining in size.
- **Estimated size: #**
- **Health:**
  - Normal Vitality = normal growth and twig extension;
  - Moderate Vitality = reduced twig extension but other than that few signs of ill-health;
  - Early Decline = reduced twig extension and some dead twigs in the outer canopy;
  - Mid-decline = small internodes, the canopy may be thinning and contain dead twigs and/or branches in the outer canopy, older branch wounds that haven't occluded may be decaying and forming cavities;
  - Severe Decline = sparse crown, numerous dead twigs and branches in the outer canopy, older branch wounds likely to be decaying and forming cavities;
  - Dead.
- **Structural Condition**
  - Acute stem union = a weak union between two or more stems at the main forking point caused by the formation of reaction wood. Mechanical pressure at the forking point increases as secondary thickening occurs increasing the risk of failure at that point.

- Acute branch union = the same principle as acute stem unions but between a stem and a branch or two branches rather than 2 main stems.
- **Estimated life**
  - The life expectancy brackets of <10 years, 10+ years, 20+ years and 40+ years accord with the guidance in BS5837:2012 and should be considered as the useful life expectancy in the location the trees are growing in. For example, a tree with significant defects growing in a quiet area could be retained for longer than a tree growing next to a busy highway or a residential building.
- **Amenity**
  - High = Growing in a place that is very publicly visible such as a next to a busy road or places where people gather. The tree is also likely to be large or very large.
  - Medium = A smaller tree growing in a very publicly visible place or a large tree growing in a place with reduced public access.
  - Low = A small to medium sized tree growing in a quiet location where it is barely or not visible to anyone other than the landowner.

**Ian Kennedy  
Wharncliffe Trees and Woodland Consultancy  
16 Hartcliffe View  
Thurgoland  
Sheffield  
S35 7BD**

**0114 288 5501  
07891 488303**

**[info@wharncliffetwc.co.uk](mailto:info@wharncliffetwc.co.uk)**