


LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details			Client Details		Risk Address	
Name:	MHN Ltd		Insurance Co.:	Chubb Insurance	Occupier:	Mr K Firth
Date of Issue:			Client Name:	Crawford	Address:	Stonecroft
			Technical Mgr:	Martin C	Address:	Hall Royd Lane
			Email:		Town:	Barnsley
			Client Ref:	SU1200023	County:	
			Address:	National Subsidence Unit	Post Code:	S75 4PP
Monitoring Details			Address:	4th Floor 30 St Pauls Square	Tel Home:	01226 790 105
Instruction Date:	20/1/12		Town:	Birmingham	Tel Work:	
First Reading Date:	01/02/2012		County:		Mobile:	
Maximum No Visits:	9		Post Code:	B3 1QZ	Other:	
Anticipated Expiry Date:	Dec 2013		Other Email:	subsidence.monitoring@crawco.co.uk	Other:	
Monitoring Int:	2 Monthly					

Target Date:															
Reading Date:		2/2/12	29/4/12	10/8/12	7/11/12	6/3/13	31/5/13	6/8/13	9/10/13						
Issue Date:		4/2/12	9/5/12	14/8/12	12/11/12	8/3/13	3/6/13	8/8/13	11/10/13						
Row No.	Point Name	X Co-ordinate	Y Co-ordinate	1	2	3	4	5	6	7	8	9	10	11	12
1		0.00	0.00												
2	1	-8.20	0.00	9.8210	9.8200	9.8185	9.8189	9.8194	9.8200	9.8196	9.8201				
3		-8.40	0.00												
4	2	-8.40	-5.00	9.6755	9.6762	9.6742	9.6759	9.6754	9.6765	9.6755	9.6775				
5		-11.90	-5.00												
6	3	-11.90	-8.70	9.4186	9.4182	9.4161	9.4177	9.4176	9.4182	9.4181	9.4194				
7	4	-19.90	-8.70	9.1490	9.1481	9.1471	9.1474	9.1461	9.1487	9.1477	9.1475				
8	5	-19.90	0.80	9.5417	9.5408	9.5413	9.5420	9.5425	9.5422	9.5420	9.5423				
9		-19.90	1.00												
10	6	-22.70	1.00	9.6176	9.6195	9.6199	9.6211	9.6214	9.6219	9.6209	9.6221				
11	7	-22.70	5.90	9.8503	9.8534	9.8525	9.8532	9.8544	9.8537	9.8547	9.8538				
12		-10.00	5.90												
13		-10.00	7.30												
14	8	-22.70	7.30	9.8759	9.8780	9.8767	9.8768	9.8787	9.8776	9.8787	9.8781				
15	9	-22.70	14.00	9.9639	9.9687	9.9707	9.9702	9.9732	9.9711	9.9708	9.9624				
16	10	-11.00	14.00	9.8582	9.8646	9.8649	9.8666	9.8687	9.8690	9.8654	9.8592				
17	11	6.00	14.00	9.9615	9.9605	9.9578	9.9600	9.9616	9.9593	9.9608	9.9616				
18	12	6.00	8.50	9.9058	9.9066	9.9046	9.9047	9.9062	9.9045	9.9065	9.9062				
19		6.00	0.00												
20		0.00	0.00												
21															
22															
23															
24															
25															
26															
27															
28															
29															
30															
31															
32															

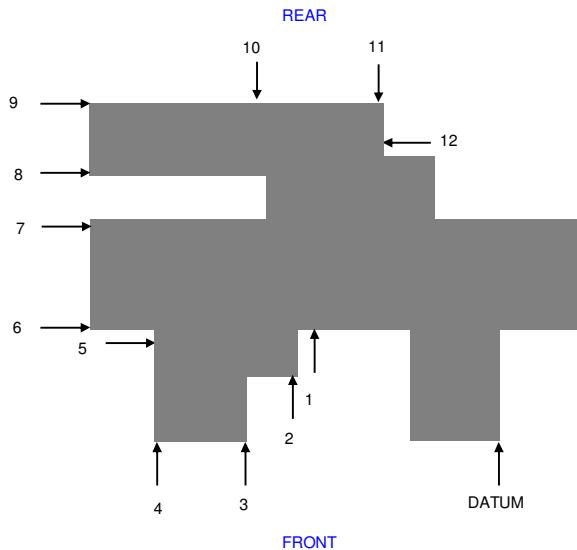


- 09/10/2013
The Occupier raised no new concerns.
NOTE: Some of the trees have been removed.
- A common brick course could not be followed, as such, relative data only.
- Readings have been made relative to a station on the property, nothing else suitable. It has an assumed value of 10.0000m. If this is not appropriate, please advise if a deep datum is required?
- Further readings to be taken in Dec-13

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: Crawford

Client Ref: SU1200023

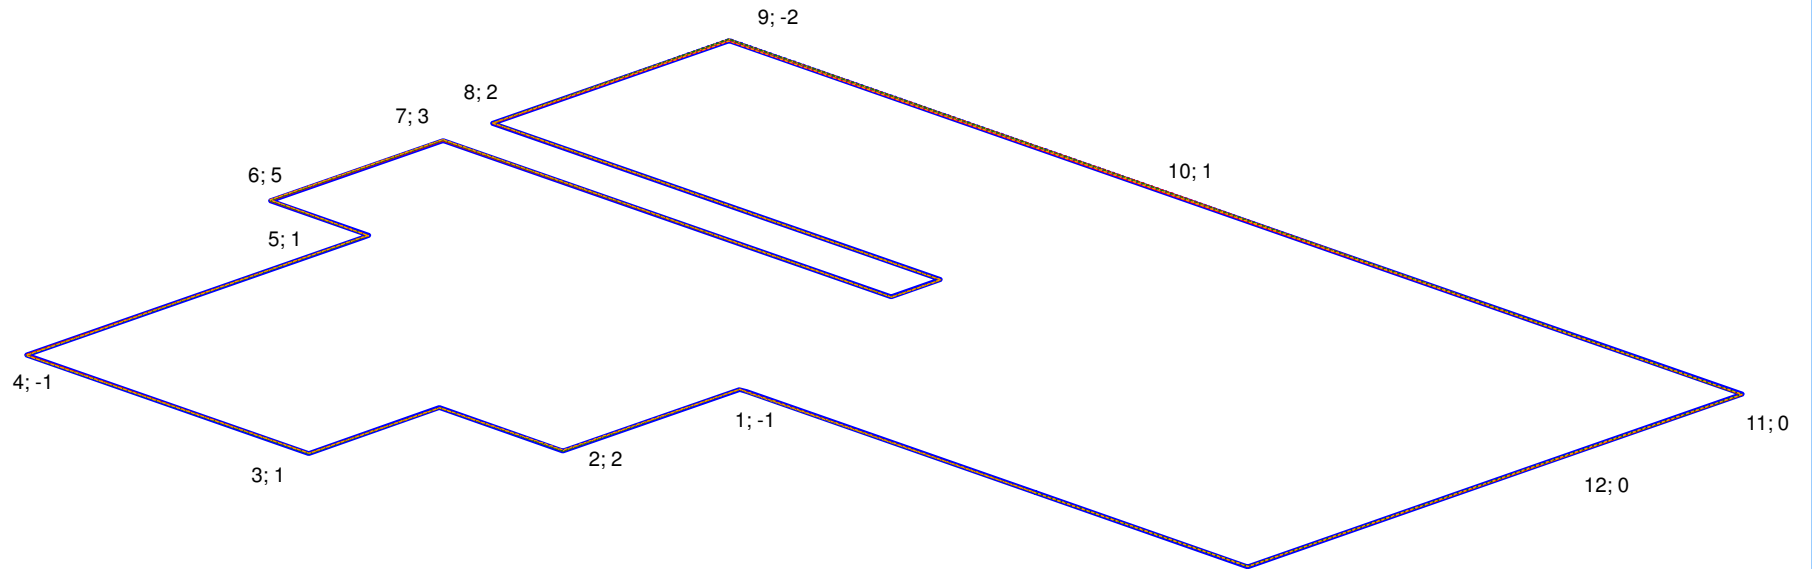

Datum Reading Reading 1 (2/2/12) Reading 2 (29/4/12) Reading 3 (10/8/12) Reading 4 (7/11/12) Reading 5 (6/3/13) Reading 6 (31/5/13)
 Reading 7 (6/8/13) Reading 8 (9/10/13) Reading 9 (0/1/00) Reading 10 (0/1/00) Reading 11 (0/1/00) Reading 12 (0/1/00)

Notes:
Vertical distorted scale 1: 10




Point labels give level difference of last reading from original datum in mm.

LEVEL MONITORING - RELATIVE SURVEY READINGS

Client: Crawford

Client Ref: SU1200023

Chart Scale 1:1000

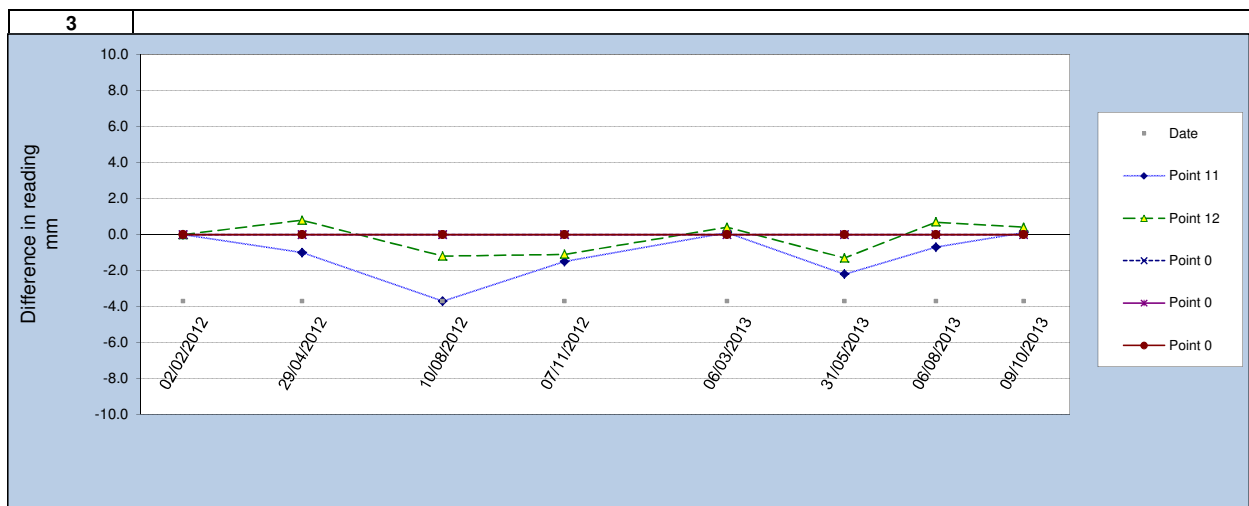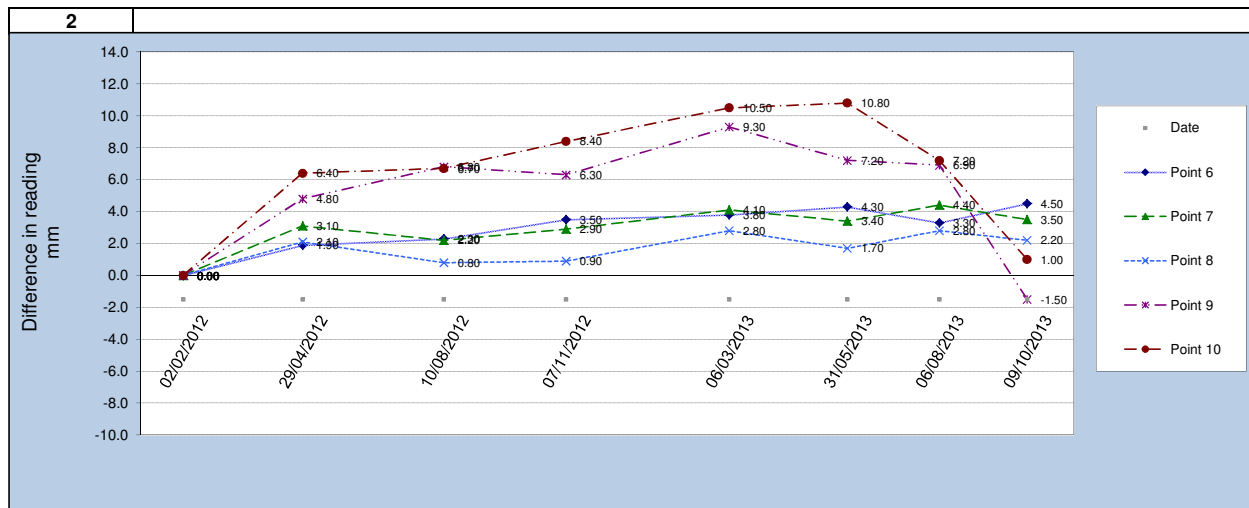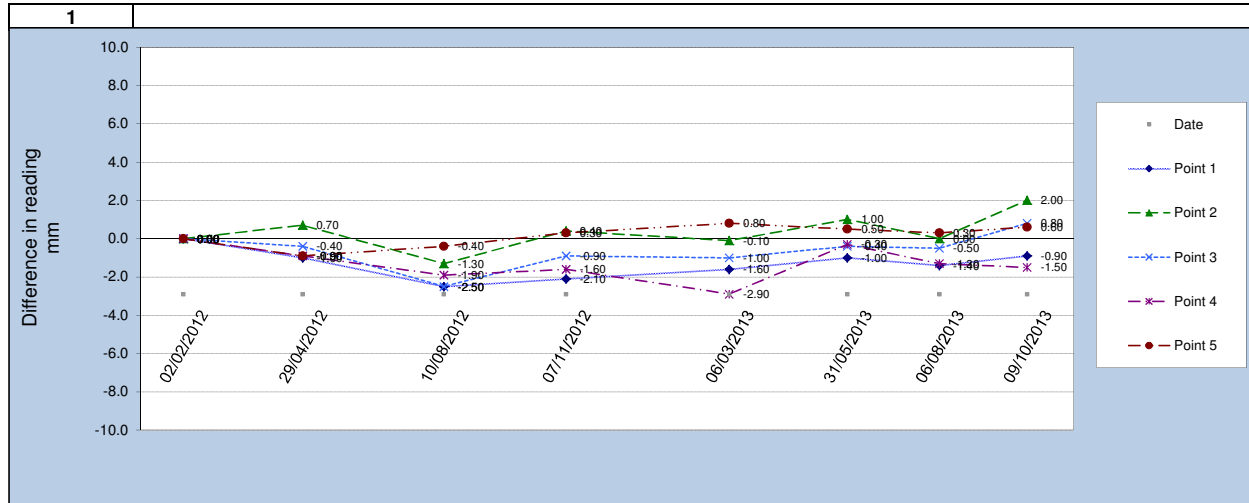

Standard Comments for selection in Readings and Sketch Worksheets

User may edit these as appropriate

Standard Comments	
No Comment	
Standard Comment 1	The Occupier expressed concerns
Standard Comment 2	The Occupier was not unduly worried
Standard Comment 3	Standard Comment 3
Standard Comment 4	Standard Comment 4
Standard Comment 5	

Standard Bullet
●