




Cannon Hall Contractors Document - Cawthorn Road Network

| Ref. | Species | Description | What 3 Words | Measurements | Survey Notes | Recommendation | Work Timescale |
|--|---|---|---------------------------------|--|---|----------------|------------------------|
| G001 | Silver birch (Betula pendula) Elm x2 (Ulmus sp.) | 3 standing dead trees near land entrance gate, next to road | /// putts.over power.cust odian | Height (m): 7 Crown Radius (m): 2 Trees: 3 Life Stage: Dead | Growing next to wall in bramble thicket. Silver birch stem has snapped out top. | Fell trees | 26-Jun-2024 (Urgent) |
| T018 | Larch (Larix sp.) | Next to road behind wall | /// supporter.cookie.enj oy | Height (m): 10 Crown Radius (m): 3 DBH (cm): 40 Life Stage: Dead | Standing dead tree. Previously ivy clad. Tangled in canopy of neighbouring sycamores. | Fell tree. | 26-Jun-2024 (Urgent) |
|  | | | | | | | |
| T038 | Oak (Quercus sp.) | Roadside, slight stress back in waterlogged area | /// blush.ani mates.pins | Height (m): 16 Crown Radius (m): 8 Life Stage: Dead | Large standing dead tree, ivy clad stem. Large branches roadside. | Fell tree | 01-Jul-2024 (Urgent) |
| G005 | Wych elm x6 (Ulmus glabra) | Roadside trees in woodland edge, opposite field entrance | /// triangles.r eorder.en vy | Height (m): 10 Crown Radius (m): 1.5 DBH (cm): 20 Trees: 6 Life Stage: Semi Mature | Standing dead trees or nearly dead trees. Some ivy clad. Two slightly set back in woodland. | Fell trees | 26-Sep-2024 (3 Months) |
| T033 | Common ash (Fraxinus excelsior) | Roadside tree. Over ivy covered wall | /// engrossed.launched.s hark | Height (m): 10 Crown Radius (m): 2 DBH (cm): 35 Life Stage: Dead | Standing dead tree, next ivy clad hawthorn. Dead but for one of two epicormic shoots Pests and Diseases: Ash Dieback Infection Level 4: 75% to 100% | Fell tree. | 01-Oct-2024 (3 Months) |

| | | | | | | | |
|------|--------------------------------|--|------------------------------|---|--|---|------------------------|
| T056 | Sycamore (Acer pseudoplatanus) | Roadside tree, set back from road. Next to street lighting | /// retraced.s plice.putte r | Height (m): 18 Crown Radius (m): 9 DBH (cm): 80 Stems: 2 Life Stage: Mature Life Exp.: 50+ Years | Tight union at main stem, slight bulge as reactionary growth. Broad form. Canopy obscuring street lighting severely. | Ensure 1m clearance around Street lighting. | 01-Oct-2024 (3 Months) |
|------|--------------------------------|--|------------------------------|---|--|---|------------------------|



| | | | | | | | |
|------|--------------------------------|---|------------------------------|---|--|------------|------------------------|
| T058 | Sycamore (Acer pseudoplatanus) | Roadside tree, slightly set back on woodland edge | /// rely.enhan ces.impeached | Height (m): 18 Crown Radius (m): 5 DBH (cm): 40 Life Stage: Mature Life Exp.: <10 years | In decline, has smaller stems at base, one dead. Large area of bark missing on main stem, around 30 percent circumference loss. Upper canopy dead, with large dead limbs throughout canopy. Main foliage is epicormic on main stem | Fell tree. | 01-Oct-2024 (3 Months) |
|------|--------------------------------|---|------------------------------|---|--|------------|------------------------|




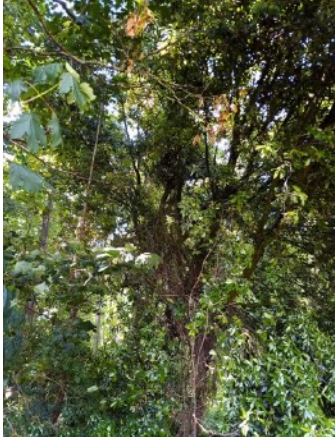


| | | | | | | | |
|------|-----------------------------------|---|---------------------------------|---|--|------------|------------------------|
| G003 | Wych elm x4 (Ulmus glabra) | Roadside strip of trees within larger group | /// wip.es.nec kline.gravit ate | Height (m): 10 Crown Radius (m): 1 DBH (cm): 35 Trees: 4 Life Stage: Dead | Standing dead trees. Live as in middle of group. All ivy clad | Fell trees | 26-Dec-2024 (6 Months) |
| G006 | Sycamore x3 (Acer pseudoplatanus) | Roadside trees in front of wall | /// vanilla.inc uring.reti na | Height (m): 11 Crown Radius (m): 2.5 Trees: 3 Life Stage: Mature Life Exp.: <10 years | Four trees in decline. Two standing dead, either side of one tree in severe decline with little canopy remaining, and one small tree in similar poor condition, with foliage all on lower branches. Two trees severely ivy clad. | Fell trees | 26-Dec-2024 (6 Months) |



| | | | | | | | |
|------|-------------------------|--|-----------------------------|---|--|------------|------------------------|
| T001 | Wych elm (Ulmus glabra) | Slightly set back from road after caravan park entrance. Proximity to power lines. | /// reserving. pegged.sa ge | Height (m): 8 Crown Radius (m): 1.5 DBH (cm): 20 Stems: 5 Life Stage: Semi Mature Life Exp.: <10 years | Dead leaves throughout canopy, stems with slight lean towards road and power lines. Little potential to recover. Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell tree. | 26-Dec-2024 (6 Months) |
|------|-------------------------|--|-----------------------------|---|--|------------|------------------------|



| | | | | | | | |
|------|------------------------------------|---|---------------------------------|---|---|---|---------------------------|
| T003 | Sycamore (Acer pseudoplatanus) | On inside bend next to road. Potential to impact power cables and phone cables. | /// windmill.s ong.safety | Height (m): 15 Crown Radius (m): 4 DBH (cm): 60 Life Stage: Mature Life Exp.: 20+ Years | Thick undergrowth around base. double stemmed at 3m. To dying back leaving some dead branches, some over roadside. Potentially in decline. | Remove deadwood - greater than 25 mm. | 26-Dec-2024 (6 Months) |
| | |  | | | |  | |
| T008 | Common ash (Fraxinus excelsior) | Field side tree set back from road and path, over road signage. | /// events.chi efs.bounty | Height (m): 10 Crown Radius (m): 4 DBH (cm): 30 Stems: 2 Life Stage: Early Mature Life Exp.: 10+ Years | Bramble undergrowth at base. Smaller than growing tree due to competition. Lower branches interfering with road signage. | Reduce S canopy to ensure 1m clearance for road signage. | 26-Dec-2024 (6 Months) |
| T009 | Common ash (Fraxinus excelsior) | End of hedgerow tree, set back down bank from road and path. | /// asking.dis posing.stri kers | Height (m): 10 Crown Radius (m): 6 DBH (cm): 45 Life Stage: Early Mature Life Exp.: 10+ Years | Fairly canopy with good foliage. Lower S like sweeping and horizontal with branches low over footpath. Ownership uncertain. | Crown lift to 3 m for pedestrian clearance. | 26-Dec-2024 (6 Months) |
| T013 | Not identified (Not identified) | Roadside dead tree | /// digests.nas al.doctor | Height (m): 6 Crown Radius (m): 2 Life Stage: Dead | Standing dead tree, leaf from hedgerow at base. | Fell tree to hedge height | 26-Dec-2024 (6 Months) |
| T016 | Holm oak (Quercus ilex) | Roadside tree over wall on woodland edge. | /// failed.dart. cowboys | Height (m): 11 Crown Radius (m): 6 DBH (cm): 35 Life Stage: Early Mature Life Exp.: 30+ Years | Dual stemmed at 2m. Roadside limb with moderate lean, heavy foliage, becoming dominant. Snapped out top from main upright limb hung up, smaller snapped branch over road. | Remove snapped out limbs. Reduce roadside canopy by 2m in line with midway point on road, to attempt to correct form. | 26-Dec-2024 (6 Months) |
| | |  | | | |  | |

| | | | | | | | |
|------|----------------------------|--|--|---|--|---|---------------------------|
| T017 | Holm oak (Quercus ilex) | | /// drifting.jo usting.thin k | Height (m): 15 Crown Radius (m): 6 DBH (cm): 45 Life Stage: Mature Life Exp.: 30+ Years | Ivy clad. Moderate lean N. Become multi-stemmed at 3m. Gas several smaller branches over road. Growing into tree canopy opposite | Remove snapped branches from canopy. Reduce NE canopy by 3m to wound midway point on road to correct form. | 26-Dec-2024 (6 Months) |
|------|----------------------------|--|--|---|--|---|---------------------------|



| | | | | | | | |
|------|--------------------------------------|---|----------------------------------|--|---|--------------------------|---------------------------|
| T019 | Sycamore (Acer pseudoplatanus) | Mutistemmed tree or group of trees on roadside over wall. | /// relief.mash .enjoyable | Height (m): 19 Crown Radius (m): 6.5 DBH (cm): 35 Stems: 6 Life Stage: Mature Life Exp.: 10+ Years | Previously ivy clad. Severed. Broad form with healthy canopy. Except for two upright stems with tight unions at base, which are dying back severely, tops completely dead, only light foliage lower down stems. | Fell two dying stems. | 26-Dec-2024 (6 Months) |
|------|--------------------------------------|---|----------------------------------|--|---|--------------------------|---------------------------|

| | | | | | | | |
|------|-----------------------------------|---|-------------------------------------|---|---|---|---------------------------|
| T021 | Common alder (Alnus glutinosa) | Roadside tree, in front of stock fencing. | /// knowledge .mops.rob ot | Height (m): 10 Crown Radius (m): 3 DBH (cm): 50 Stems: 6 Life Stage: Mature Life Exp.: 20+ Years | Two major stems with 4 smaller stems amongst lower growth. S main stem appears weak with multiple large dead branches and sparse foliage. Several cavities noted up main stem and insect and bird holes higher on stem. Other main appears healthier with occasional dead tips and a few larger dead branches. | Remove S stem to ground level. Remove substantial deadwood. | 26-Dec-2024 (6 Months) |
|------|-----------------------------------|---|-------------------------------------|---|---|---|---------------------------|











| | | | | | | | |
|------|---------------------------------|---|--------------------------------|---|---|----------------------------|------------------------|
| T022 | Common ash (Fraxinus excelsior) | Roadside tree in hedgerow, a entrance to PROW | /// blues.insurance.some where | Height (m): 13 Crown Radius (m): 5 Life Stage: Mature Life Exp.: 10+ Years | Completely ivy clad. Tips dying back all around canopy, inner canopy fairly thick with vigorous new growth. . Pests and Diseases: Ash Dieback Infection Level 2: 25% to 50% | Sever ivy. | 26-Dec-2024 (6 Months) |
| T023 | Common ash (Fraxinus excelsior) | Roadside tree in hedgerow. | /// lasts.bean s.fulfilled | Height (m): 6 Crown Radius (m): 2.5 Life Stage: Over Mature Life Exp.: <10 years | Nearly completely dead. Ivy clad. Only remaining foliage is small amount of epicormic growth in centre. Several large dead branches, two with potential to fail roadside. | Remove dead roadside limbs | 26-Dec-2024 (6 Months) |






| | | | | | | | |
|------|-------------------------|---|-----------------------------|---|--|------------|------------------------|
| G011 | Wych elm (Ulmus glabra) | Small group of roadside trees. Not including larger healthy elms near field entrance. | /// wiggling.re lax.painted | Height (m): 8 Crown Radius (m): 2 Life Stage: Semi Mature Life Exp.: <10 years | Small trees weakening and dying, withering foliage. Some stems completely dead. Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell trees | 01-Jan-2025 (6 Months) |
|------|-------------------------|---|-----------------------------|---|--|------------|------------------------|



| | | | | | | | |
|---|---|--|----------------------------------|--|--|------------|---------------------------|
| G012 | Wych elm x6 (Ulmus glabra) | Trees set back from roadside behind wall growing amongst mature sycamores. | /// freshest.d efends.un painted | Height (m): 8 Crown Radius (m): 3 DBH (cm): 25 Trees: 6 Life Stage: Semi Mature Life Exp.: <10 years | Several standing dead and dying trees growing in woodland edge and at track entrance. Tree at track entrance is dual stemmed, larger with some ivy on main stems, growing into neighbouring sycamore. Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell trees | 01-Jan-2025 (6 Months) |
| G013 | Elder (Sambucus nigra) Common ash x3 (Fraxinus excelsior) Wych elm x4 (Ulmus glabra) | Small group of trees next to road behind barrier. | /// unwraps.b umping.ca re | Height (m): 10 Crown Radius (m): 2 DBH (cm): 40 Trees: 8 Life Stage: Semi Mature Life Exp.: <10 years | 4 of the elm are standing dead, with larger elm weak with little foliage remaining. Many stems ivy clad. Some elder. Ash are tall form with little lower foliage. Exposed, especially with removal of elm. Hazel undergrowth. Elder with moderate lean growing into road. | Fell trees | 01-Jan-2025 (6 Months) |
|  | | | |  | | | |
| T036 | Pedunculate oak (Quercus robur) | Roadside tree on bend | /// awkward. tiny.triathlon | Height (m): 12 Crown Radius (m): 5 DBH (cm): 100 Life Stage: Mature Life Exp.: 30+ Years | Growing in hedge row. Severe vehicle damage to main stem at around 3.5m. Multiple wound, some sealing. Some debris from danger vehicle still present and scattered around road. Leaning form. Stem grows slightly into road, mitigation of damage not possible without impact to traffic safety. | Fell tree | 01-Jan-2025 (6 Months) |
|  | | | |  | | | |

| | | | | | | | |
|---|-----------------------------------|---|-------------------------------------|---|---|--|---------------------------|
| T037 | Sycamore (Acer pseudoplatanus) | Roadside tree, in lower norcroft farm garden. | /// steadier.unheated.s nores | Height (m): 17 Crown Radius (m): 5 DBH (cm): 85 Life Stage: Mature Life Exp.: <10 years | Growing in copse of established nature trees. Butteress roots, one damaged in fence installation, some decay in butteresses w side of tree with soft root. Leading to area of necrotic bark with exposed heartwood, large area leaving around 60 percent circumference of live tissue. Multiple dead branches in lower canopy, and heavily crown lifted, some major limbs removed leaving wound areas, good habitat. Sparse open upper canopy some deadwood. Slight lean NW away from road. | Remove all substantial dead. | 01-Jan-2025 (6 Months) |
|  | | | |  | |  | |
| T039 | Sycamore (Acer pseudoplatanus) | Roadside tree behind stock fence. | /// sprinting.fr uity.detect | Height (m): 13 Crown Radius (m): 4 DBH (cm): 45 Life Stage: Mature Life Exp.: 30+ Years | Large dead branches. Healthy stem low down. Lightening damage: dead to with multiple dead branches in a line, lenticular splits from to to midway point | Remove major deadwood and dead branches | 01-Jan-2025 (6 Months) |
|  | | | | | | | |



| | | | | | | | |
|------|-------------------------------------|---|-----------------------------|---|--|--|---------------------------|
| T040 | Sycamore (Acer pseudoplatanus) | Road side tree, slightly set back from the road. | /// grab.custodial.towels | Height (m): 15 Crown Radius (m): 5 DBH (cm): 65 Stems: 2 Life Stage: Mature Life Exp.: <10 years | Dual stemmed. Western stem nearly completely dead. Severe decay at base including main union. Roadside stem with split up back and exposed heartwood with rot. Dead top with dieback further down. | Fell tree. | 01-Jan-2025 (6 Months) |
| | |  | | | |  | |
| T044 | Sweet chestnut (Castanea sativa) | Roadside tree, behind small way | /// slyly.mulls.pinch | Height (m): 7 Crown Radius (m): 1 DBH (cm): 40 Life Stage: Dead | Standing dead tree. | Fell tree. | 01-Jan-2025 (6 Months) |
| T045 | Wych elm (Ulmus glabra) | Roadside tree, behind short wall, next to bend in road sign | /// parading.duty.overtones | Height (m): 11 Crown Radius (m): 2 DBH (cm): 30 Life Stage: Dead | Standing dead tree | Fell tree. | 01-Jan-2025 (6 Months) |
| T046 | Wych elm (Ulmus glabra) | Roadside tree, this side of wall | /// cobras.glide.incorrect | Height (m): 8 Crown Radius (m): 2 DBH (cm): 20 Stems: 4 Life Stage: Dead | Standing dead multi-stemmed tree. | Fell tree. | 01-Jan-2025 (6 Months) |
| T050 | Sycamore (Acer pseudoplatanus) | Roadside tree opposite lane head farm entrance next to small group of sycamore. | /// clips.january.unloads | Height (m): 5 Crown Radius (m): 1 DBH (cm): 20 Life Stage: Dead | Standing dead tree | Fell tree | 01-Jan-2025 (6 Months) |
| | |  | | | | | |

| | | | | | | | |
|------|-----------------------------------|--|--------------------------------------|--|---|------------|---------------------------|
| T051 | Sycamore (Acer pseudoplatanus) | | /// shelving.th rashed.bo ater | Height (m): 7 Crown Radius (m): 3 DBH (cm): 45 Stems: 2 Life Stage: Semi Mature Life Exp.: <10 years | Majority of tree dead, some basal growth evident. | Fell Tree | 01-Jan-2025 (6 Months) |
| G002 | Wych elm x3 (Ulmus glabra) | Strip of 3 trees next to road, one other side of boundary wall | /// rifled.benc hed.extre mely | Height (m): 5 Crown Radius (m): 2 DBH (cm): 25 Trees: 3 Life Stage: Semi Mature Life Exp.: <10 years | 3 trees with clear Dutch elm symptoms, all in poor condition with the one over the wall nearly completely dead. One has Oak sapling growing at base. Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell trees | 26-Jun-2025 (1 Year) |



| | | | | | | | |
|------|-----------------------------------|--|------------------------------------|---|--|--|-------------------------|
| T002 | Sycamore (Acer pseudoplatanus) | Next to caravan park and outbuildings. | /// able.likewi se.remakin g | Height (m): 16 Crown Radius (m): 2 DBH (cm): 40 Life Stage: Mature Life Exp.: <10 years | Completely dead top. Lower 50% canopy made up o epicormic and one live branch. | Remove dead top leaving totem with new growth. | 26-Jun-2025 (1 Year) |
|------|-----------------------------------|--|------------------------------------|---|--|--|-------------------------|



| | | | | | | | |
|------|------------------------------------|---|---------------------------------|--|---|--|-------------------------|
| T004 | Common ash (Fraxinus excelsior) | Next to road, power cables through canopy | /// overdrive. drag.attention | Height (m): 9 Crown Radius (m): 3.5 DBH (cm): 30 Stems: 2 Life Stage: Early Mature Life Exp.: 20+ Years | Hedgerow tree growing with hawthorn and hazel. Single stems growing out over road with severe lean, epicormic growth on stem. | Remove stem back to hedge | 26-Jun-2025 (1 Year) |
| | |  | |  | | | |
| T006 | Pedunculate oak (Quercus robur) | Between road and field. Under power cables. | /// unlocking. salmon.ba rstool | Height (m): 8 Crown Radius (m): 4 DBH (cm): 45 Stems: 2 Life Stage: Mature Life Exp.: 50+ Years | Small squat form. Potentially due to power utilities pruning. Small snapped branch directly over road. | Crown lift to 5.2 m for highway clearance and remove snapped branches. | 26-Jun-2025 (1 Year) |
| T007 | Common ash (Fraxinus excelsior) | Roadside tree, over wall. | /// lashed.opposite.ramps | Height (m): 11 Crown Radius (m): 4 Life Stage: Mature Life Exp.: <10 years | Ivy clad main stem. Severe ADB symptoms, roots drying back throughout canopy, foliage made up of epicormic growth along branches. Little internal canopy. Pests and Diseases: Ash Dieback Infection Level 3: 50% to 75% | Fell tree. | 26-Jun-2025 (1 Year) |
| T010 | Common beech (Fagus sylvatica) | Roadside tree, next to neighbouring garage. | /// wealth.painters.happening | Height (m): 11 Crown Radius (m): 5.5 DBH (cm): 60 Life Stage: Early Mature Life Exp.: 50+ Years | Broad squat form. In corner of field. Branches interfering with garage roof and windows. | Reduce branches to ensure 1m clearance from neighbouring garage. Crown lift to 5.2 m for highway clearance. | 26-Jun-2025 (1 Year) |
| T011 | Wych elm (Ulmus glabra) | Roadside tree under power cables. | /// educates.chef.univers al | Height (m): 6 Crown Radius (m): 1.5 Life Stage: Semi Mature Life Exp.: <10 years | Nearly completely dead tree. Ivy clad, all upper canopy dead with some withered leaf lower down. Under and interfering with power cables. | Fell tree. | 26-Jun-2025 (1 Year) |



| | | | | | | | |
|------|---------------------------------|--|----------------------------|---|---|---|---|
| T012 | Pedunculate oak (Quercus robur) | Set back from road, within parkland to S of track. | /// hook.wear y. fulfilled | Height (m): 21 Crown Radius (m): 9 DBH (cm): 140 Life Stage: Over Mature Life Exp.: 20+ Years | Large specimen, broad form, multi stemmed from 3.5m. Butteress roots with some cavities beginning to form. Fungal brackets around base in several butteresses, senescent so exact ID unclear. Canopy appears healthy and full with minimal dead branches. Tree has clear lean S. 4 or so tear stubs from previous snap outs, historic | Further inspection using tomography to assess structural integrity of main stem and butt. | FOR SURVEYOR NOT CONTRACTOR 26-Jun-2025 (1 Year) |
|------|---------------------------------|--|----------------------------|---|---|---|---|




| | | | | | | | |
|------|---------------------------------|------------------------------|-----------------------------|---|---|--|----------------------|
| T015 | Common ash (Fraxinus excelsior) | Roadside tree, next to wall. | /// solo.alarm ed.clattered | Height (m): 10 Crown Radius (m): 3 DBH (cm): 50 Life Stage: Mature Life Exp.: 10+ Years | Ivy clad lowest limb and upper canopy dead, naturally retrenching. Foliage appears healthy. | Remove dead top and other substantial deadwood Sever ivy | 26-Jun-2025 (1 Year) |
|------|---------------------------------|------------------------------|-----------------------------|---|---|--|----------------------|

| | | | | | | | |
|------|---------------------------------|-----------------------------------|------------------------------|--|--|-----------------------------------|----------------------|
| T020 | Pedunculate oak (Quercus robur) | Roadside tree, Infront of railing | /// dent. distanced. own ers | Height (m): 9 Crown Radius (m): 4 DBH (cm): 60 Life Stage: Mature Life Exp.: 30+ Years | Ivy clad main stem. Stunted form, possibly from previous failure of main stem. Secondary stem dead and standing verticle through canopy. | Remove large dead stem Sever ivy. | 26-Jun-2025 (1 Year) |
|------|---------------------------------|-----------------------------------|------------------------------|--|--|-----------------------------------|----------------------|



| | | | | | | | |
|------|------------------------------------|--|--------------------------------|--|---|---|---|
| T022 | Common ash (Fraxinus excelsior) | Roadside tree in hedgerow, a entrance to PROW | /// blues.insurance.some where | Height (m): 13 Crown Radius (m): 5 Life Stage: Mature Life Exp.: 10+ Years | Completely ivy clad. Tips dying back all around canopy, inner canopy fairly thick with vigorous new growth. . Pests and Diseases: Ash Dieback Infection Level 2: 25% to 50% | Review ADB levels and response to ivy severing. | FOR SURVEYOR NOT CONTRACTOR 26-Jun-2025 (1 Year) |
| | | | |  | | | |
| T025 | Common ash (Fraxinus excelsior) | In woodland edge, set back from road and path. | /// project.painter.blanking | Height (m): 7 Crown Radius (m): 2 DBH (cm): 20 Life Stage: Early Mature Life Exp.: <10 years | Some ivy on main stem. Severe lean over road. On upright growth has died. Poor form with future failure potential. | Fell tree. | 26-Jun-2025 (1 Year) |
| | | | |  | | | |
| T028 | Common ash (Fraxinus excelsior) | | /// communal .removers. fans | Height (m): 12 Crown Radius (m): 2 DBH (cm): 30 Life Stage: Mature Life Exp.: <10 years | Previously ivy clad. Moderate to slight lean N (roadside). Moderate to severe ADB symptoms. No lower canopy. Pests and Diseases: Ash Dieback Infection Level 3: 50% to 75% | Fell tree. | 26-Jun-2025 (1 Year) |
| T029 | Sycamore (Acer pseudoplatanus) | Next to road, over drainage ditch | /// height.watched.dispensed | Height (m): 8 Crown Radius (m): 1.5 DBH (cm): 25 Life Stage: Early Mature Life Exp.: <10 years | In decline. Lots of dead branches and peeling bark. Sporadic growth mainly lower on dying branches. | Fell tree. | 26-Jun-2025 (1 Year) |

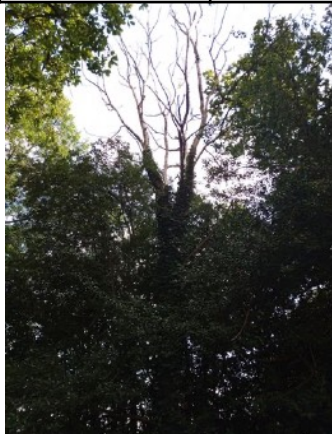

| | | | | | | | |
|------|-------------------------|---|-----------------------------|--|--|------------|----------------------|
| T030 | Wych elm (Ulmus glabra) | Roadside tree, between holly and hawthorn | /// prep.anim al.limeligh t | Height (m): 7 Crown Radius (m): 2 DBH (cm): 30 Life Stage: Dead | Standing dead tree. Ivy clad main stem | Fell tree. | 26-Jun-2025 (1 Year) |
|------|-------------------------|---|-----------------------------|--|--|------------|----------------------|




| | | | | | | | |
|------|-------------------------|---------------|------------------------------|--|-------------------------------|------------|----------------------|
| T031 | Wych elm (Ulmus glabra) | Roadside tree | /// crunching. affords.cak e | Height (m): 8 Crown Radius (m): 2 DBH (cm): 35 Life Stage: Dead | Standing dead tree, ivy clad. | Fell tree. | 26-Jun-2025 (1 Year) |
|------|-------------------------|---------------|------------------------------|--|-------------------------------|------------|----------------------|





| | | | | | | | |
|------|------------------------------------|---|------------------------------|---|--|------------|----------------------|
| G007 | Common ash x3 (Fraxinus excelsior) | Roadside trees. Tree next to sycamore group with rose growing at base | /// interviewe r.shots.glu e | Height (m): 10 Crown Radius (m): 3 DBH (cm): 30 Trees: 3 Life Stage: Early Mature Life Exp.: <10 years | One tree multi stemmed. All trees ivy clad. Severely dying back. All three have upright form. One tree almost completely dead. Pests and Diseases: Ash Dieback Infection Level 3: 50% to 75% | Fell trees | 01-Jul-2025 (1 Year) |
|------|------------------------------------|---|------------------------------|---|--|------------|----------------------|







| | | | | | | | |
|---|---------------------------------------|--|--------------------------------|---|---|------------|-------------------------|
| G008 | Common ash x3 (Fraxinus excelsior) | Row of three road side tree, close together. | /// crumples. demandin g.tomb | Height (m): 14 Crown Radius (m): 4 DBH (cm): 40 Trees: 3 Life Stage: Mature Life Exp.: <10 years | Severely ivy clad. Dying tips, mainly at top, little potential for regrowth. Pests and Diseases: Ash Dieback Infection Level 2: 25% to 50% | Fell trees | 01-Jul-2025 (1 Year) |
|  | | | | | | | |
| G009 | Common ash x4 (Fraxinus excelsior) | Tight group of roadside trees, opposite road drain | /// soils.zinc.s treaks | Height (m): 14 Crown Radius (m): 3 Trees: 4 Life Stage: Mature Life Exp.: <10 years | Severely ivy clad, dying at tips, little growth in lower canopy, no epicormic response. Holly growing behind. Pests and Diseases: Ash Dieback Infection Level 3: 50% to 75% | Fell trees | 01-Jul-2025 (1 Year) |
|  | | | | | | | |
| G010 | Wych elm x38 (Ulmus glabra) | Strip of roadside trees and whips, either side of low wall | /// walls.char acter.shar pens | Height (m): 9 Trees: 38 Life Stage: Semi Mature Life Exp.: <10 years | Group of young trees with saplings, all weak and dying, some completely dead. Some healthy hawthorn trees within group Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell trees | 01-Jul-2025 (1 Year) |

| | | | | | | | |
|------|------------------------------------|--|-----------------------------|--|--|------------|-------------------------|
| T034 | Wych elm (Ulmus glabra) | Roadside tree, at corner of wall next to path entrance . | /// manicured .sprayer.urge | Height (m): 12 Crown Radius (m): 1 DBH (cm): 20 Stems: 2 Life Stage: Semi Mature Life Exp.: <10 years | 2 stems twisted together. Main stem nearly completely dead. Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell trees | 01-Jul-2025 (1 Year) |
| | | | |  | | | |
| T035 | Wych elm (Ulmus glabra) | Dead tree on bank next to bridge, roadside | /// shunts.pri nters.pran k | Height (m): 12 Crown Radius (m): 2 DBH (cm): 25 Life Stage: Dead | Standing dead tree, ivy clad. Slight lean W | Fell tree. | 01-Jul-2025 (1 Year) |
| T041 | Common ash (Fraxinus excelsior) | Roadside tree, next to wooden fence | /// daredevil.r attled.loaf | Height (m): 8 Crown Radius (m): 1 DBH (cm): 15 Life Stage: Dead | Small dead standing tree, ivy main stem | Fell tree. | 01-Jul-2025 (1 Year) |
| | | | |  | | | |
| T042 | Wych elm (Ulmus glabra) | Roadside tree, next to hawthorn | /// writing.steam.corrupted | Height (m): 9 Crown Radius (m): 1 DBH (cm): 20 Stems: 2 Life Stage: Dead | Standing dead tree | Fell tree. | 01-Jul-2025 (1 Year) |

| | | | | | | | |
|---|-----------------------------------|---|--|--|--|---|--|
| T043 | Sycamore (Acer pseudoplatanus) | Roadside tree | /// irony.shee p.drilled | Height (m): 8 Crown Radius (m): 3 DBH (cm): 20 Stems: 2 Life Stage: Semi Mature Life Exp.: 30+ Years | Dual stemmed. Snapped out branches over road, one large dead branch on smaller stem with sunken canker at union | Remove dead limb on smaller stem, and remove snapped and hung up branches | 01-Jul-2025 (1 Year) |
|  | | | | | | | |
| T049 | Sycamore (Acer pseudoplatanus) | Roadside tree opposite lane head farm | /// sampling.t radition.ch ariots | Height (m): 6 Crown Radius (m): 2 DBH (cm): 20 Stems: 5 Life Stage: Semi Mature Life Exp.: 30+ Years | Small tree next to hedge row. One stem with dead to and decay on main stem | Remove stem with dead top | 01-Jul-2025 (1 Year) |
| T055 | Wych elm (Ulmus glabra) | Road side tree, other side of wall | /// collapsed.l itigate.sea weed | Height (m): 7 Crown Radius (m): 2 DBH (cm): 15 Life Stage: Young Life Exp.: <10 years | Nearly dead tree. Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell tree. | 01-Jul-2025 (1 Year) |
| T060 | Sycamore (Acer pseudoplatanus) | Dead tree covered in dead ivy with orange marker dot facing Road | /// flask.surve y.snapping | Height (m): 5 Crown Radius (m): 2 DBH (cm): 30 | | Fell tree | 01-Jul-2025 (1 Year) |
| G014 | Wych elm x4 (Ulmus glabra) | Roadside trees. | /// nerd.crow bar.fine | Height (m): 5 Crown Radius (m): 2 DBH (cm): 25 Trees: 4 Life Stage: Dead | Standing dead trees in close grouping, one neighbouring healthy Elm Pests and Diseases: Dutch Elm Disease (Ophiostoma novo-ulmi) | Fell trees | 02-Jul-2025 (1 Year) |
| T003 | Sycamore (Acer pseudoplatanus) | On inside bend next to road. Potential to impact power cables and phone cables. | /// windmill.s ong.safety | Height (m): 15 Crown Radius (m): 4 DBH (cm): 60 Life Stage: Mature Life Exp.: 20+ Years | Thick undergrowth around base. double stemmed at 3m. To dying back leaving some dead branches, some over roadside. Potentially in decline. | Monitor tree vitality and taste of dieback. | FOR SURVEYOR NOT CONTRACTOR 01-Jul-2026 (2 Years) |

| | | | | | | | |
|---|------------------------------------|---|---------------------------------------|---|---|---|--|
| T005 | Common ash (Fraxinus excelsior) | Dual stemmed roadside tree. Next to wall. | /// oath.moth ering.singl es | Height (m): 14 Crown Radius (m): 5 DBH (cm): 35 Stems: 2 Life Stage: Mature Life Exp.: 10+ Years | Dual stemmed. Slightly weakened canopy, sparse foliage with no internal growth. Smaller stem with wound from previous limb removal, creating split to rear. Also has strong lean over road with poor form, future potential hazard. | Reduce smaller leaning stem back to first major upright branch. | 26-Jun-2026 (2 Years) |
|  | | | |  | | | |
| T014 | Common ash (Fraxinus excelsior) | In corner of field at road and PROW junction. Slightly set back from road | /// coil.plodd ed.nightlif e | Height (m): 12 Crown Radius (m): 7 DBH (cm): 50 Life Stage: Mature Life Exp.: <10 years | Slightly weakening canopy, sparse foliage, some dieback at tips, light. Some smaller branches completely dead. Some recently shed limbs at base. Large wound at base and in first main limb. Mainly sealing well. Fungal bracket on main stem, blackened and old, ID difficult Fungus: Inonotus spp | Resurvey to assess rate of decline and spread of fungal bracket | FOR SURVEYOR NOT CONTRACTOR 01-Jul-2026 (2 Years) |
|  | | | |  | | | |

| | | | | | | | |
|------|------------------------------------|---|--------------------------------|---|---|---|---|
| T026 | Common ash (Fraxinus excelsior) | Next to footpath and road, on woodland edge | /// sometimes .bless.ship | Height (m): 17 Crown Radius (m): 7 DBH (cm): 40 Stems: 2 Life Stage: Mature Life Exp.: 10+ Years | Canopy appears even and healthy, good foliage. Some light deadwood but nothing of concern. Main stems have very tight union leaning down to butt, with slight crack in bark on both sides. Potential future failure point. Roadside stem has strong lean towards road, with the other stem having a slight lean into woodland. | Remove roadside stem | 26-Jun-2026 (2 Years) |
| T037 | Sycamore (Acer pseudoplatanus) | Roadside tree, in lower norcroft farm garden. | /// steadier.u nheated.s nores | Height (m): 17 Crown Radius (m): 5 DBH (cm): 85 Life Stage: Mature Life Exp.: <10 years | Growing in copse of established nature trees. Butteress roots, one damaged in fence installation, some decay in butteresses w side of tree with soft root. Leading to area of necrotic bark with exposed heartwood, large area leaving around 60 percent circumference of live tissue. Multiple dead branches in lower canopy, and heavily crown lifted, some major limbs removed leaving wound areas, good habitat. Sparse open upper canopy some deadwood. Slight lean NW away from road. | Monitor tree vitality, spread of decay. | FOR SURVEYOR NOT CONTRACTOR 01-Jul-2026 (2 Years) |
| | |  | |  | | | |
| T057 | Pedunculate oak (Quercus robur) | North side of road. Road side tree. | /// bill.stack.e lectrode | Height (m): 9 Crown Radius (m): 7 DBH (cm): 45 Life Stage: Mature Life Exp.: 30+ Years | Strong lean S. Climbers up main stem. Lowest branches with wound from historic tear outs, branches further from wounds are long and horizontal with heavy end weight. Strange form due to competition. Little potential for improvement. | Fell tree. | 01-Jul-2026 (2 Years) |
| | |  | |  | | | |