


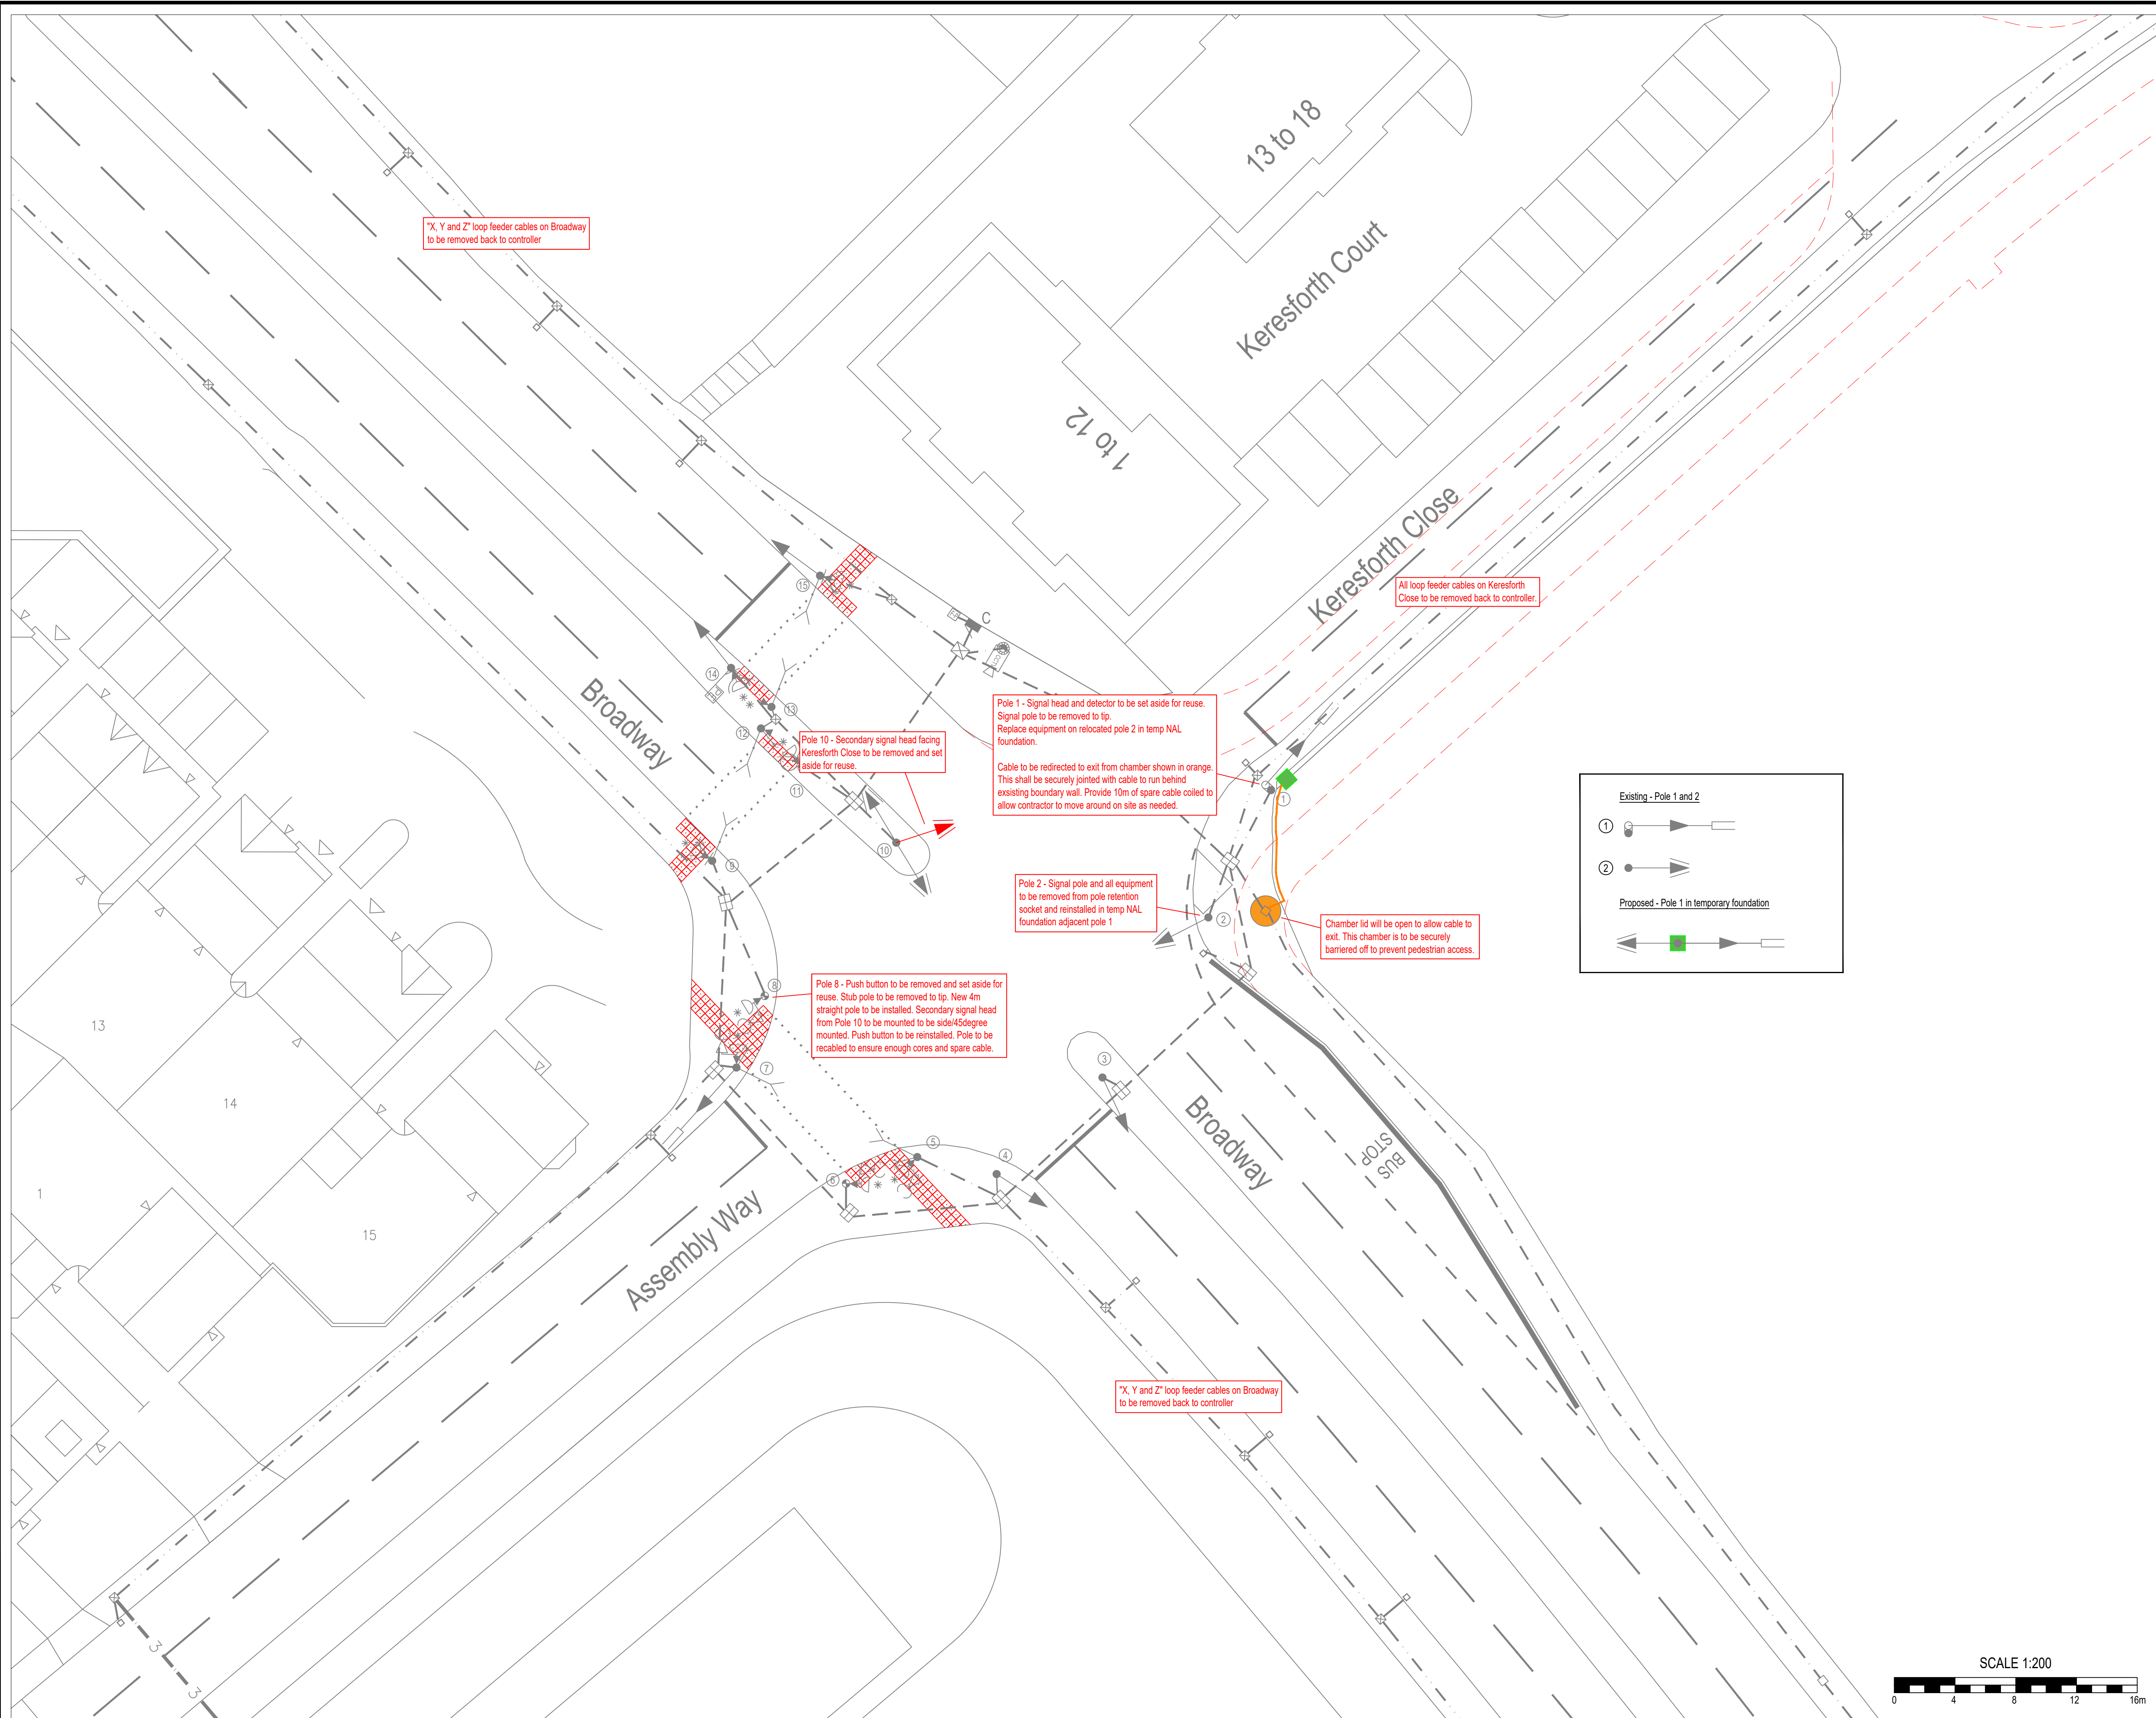


X, Y and Z loop feeder cables on Broadway to be removed back to controller

All loop feeder cables on Keresforth Close to be removed back to controller.

Pole 1 - Signal head and detector to be set aside for reuse. Signal pole to be removed to tip. Replace equipment on relocated pole 2 in temp NAL foundation.
Cable to be redirected to exit from chamber shown in orange. This shall be securely jointed with cable to run behind existing boundary wall. Provide 10m of spare cable coiled to allow contractor to move around on site as needed.

Pole 8 - Push button to be removed and set aside for reuse. Stub pole to be removed to tip. New 4m straight pole to be installed. Secondary signal head from Pole 10 to be mounted to be side/45degree mounted. Push button to be installed. Pole to be recabled to ensure enough cores and spare cable.

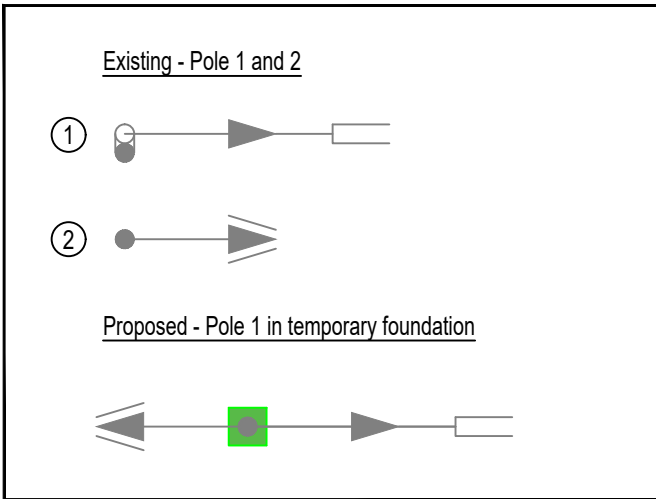

Chamber lid will be open to allow cable to exit. This chamber is to be securely barriered off to prevent pedestrian access.

X, Y and Z loop feeder cables on Broadway to be removed back to controller

Based upon Ordnance Survey Digital Mapping with permission of the Controller of Her Majesty's Stationery Office.
CROWN COPYRIGHT RESERVED
Unauthorised reproduction infringes Crown Copyright and may lead to prosecution or civil proceedings
Licence No.: 100022264

Rev.	By	Amendments	Date



Project Broadway/Keresforth Close Traffic Signal Upgrade			
Drawing title Accommodation Works			
Scale As Shown @ A1	Drawn D. Ellis	Checked	Date Nov. 2023
Drawing No. TS-169-006 (Accommodation Works)			File TS-169
Paul Castle, Service Director Environment & Transport, Place Directorate, PO Box 609, Barnsley, S70 9FH Tel. (01226) 773555 Fax. (01226) 772110			